NATIONAL ADVISORY COMMITTEE FOR AERONAUTICS

TECHNICAL NOTE

No. 989

SURVEY OF ADHESIVES AND ADHESION

By R. C. Rinker and G. M. Kline
National Bureau of Standards

NACA

Washington
August 1945

NATIONAL ADVISORY COMMITTEE FOR AERONAUTICS

TECHNICAL NOTE NO. 989

SURVEY OF ADHESIVES AND ADHESION

By R. C. Rinker and G. M. Kline

SUMMARY

The development of adhesives for bonding metal, wood, rubber, and plastic parts on aircraft has been largely empirical. A better understanding of the physical and chemical forces involved in adhesion is needed for further rational improvement of bonding materials for use in aircraft construction.

A research project has been undertaken at the National Bureau of Standards under the sponsorship of the National Advisory Committee for Aeronautics to obtain information on the strengths of bonds between different chemical types of adhesives and adherends. The present report, which covers a survey of the present knowledge on the nature of adhesion, has been prepared as the initial step in this investigation.

The scope of the survey is indicated by the following outline:

I. Theoretical aspects of adhesion.
   A. Intermolecular and interatomic forces. The four types of bonds involved in the attractive forces holding matter together are reviewed.
      1. Electrostatic or polar bonds.
      2. Covalent bonds.
         a. True covalent bonds.
         b. Coordinate covalent bonds.
      3. Metallic bonds.
      4. Van der Waals forces.

   B. The nature of cohesion. The effects of the intermolecular and interatomic forces as measured by the physical behavior of substances held together by each type are discussed.

1. Crystalline matter.
   a. Covalent crystals.
   b. Ionic crystals.
   c. Coordinate covalent crystals.
   d. Crystals containing hydrogen bonds.
   e. Metallic crystals.
   f. Van der Waals forces in crystals.
2. Noncrystalline matter.
   a. Metals.
   b. Glass.
   c. Wood.
   d. Natural and synthetic high polymers.
C. The nature of adhesion. The chemical and physical
   forces through which the various types of adhesives
   are attached to solid surfaces are surveyed.
   1. Theories concerning adhesion.
      a. McBain.
      b. Forest Products Laboratory.
   2. Chemical properties of surfaces.
   3. Mechanism of adsorption.
      a. Adsorption phenomena, general.
      b. Adsorption phenomena at glue lines.
   4. Fundamental approaches to the determination of the
      nature of adhesion.
      a. The Bartell cell.
      b. Heat of wetting.
      c. Heat of formation.
II. Properties of adhesively bonded structures.
   A. Physical strength of bonds.
      1. Mechanical behavior phenomena.
      2. Effect of thickness of glue line on strength.
         a. Experimental evidence.
         b. Probability of flaws.
         c. Surface smoothness.
         d. Effect of curing conditions.
      3. Problem of thermal expansion differences.
   B. Test methods for bond strengths.
      1. Tensile strength.
      2. Shear.
III. Bibliography.
   A. Literature references in text of report.
   B. References to other pertinent literature.
      1. Technical publications.
      2. Patents.
      3. Aircraft manufacturers' reports.
      4. Adhesive manufacturers' reports.
      5. U.S. Government reports.
      6. British Government reports.

I. THEORETICAL ASPECTS OF ADHESION

A. INTERMOLECULAR AND INTERATOMIC FORCES (REFERENCES 1 AND 2)

All matter is composed of discrete particles or atoms which are held together by electrical forces of attraction. These forces operate between the positively charged atomic nuclei and the negatively charged orbital electrons. By studying the physical and chemical properties of compounds of atoms it has been possible to recognize certain types of these attractions as differing from others. These differences, however, are not distinct and only in extreme cases is a bond a manifestation of a pure type. It is much closer to the truth to think of these bonds as having well defined properties, but to bear in mind that the transition from one type to another is not sharp but may be very gradual. When a bond is formed it does not mean that all the forces between the electrons and nuclei of the two participating atoms have been neutralized, but rather that a force concentration has been set up in a certain direction. Residual energy is always present.

In explaining chemical and physical phenomena it is convenient to recognize four general types of bonds:

Electrostatic

Covalent

Metallic

Residual bonding attraction forces, commonly known as Van der Waals forces.

1. Electrostatic or Polar Bonds

Kossel (reference 3) in 1916 showed that an element immediately preceding a rare gas in the Periodic Table is strongly electronegative; whereas one immediately following it is strongly electropositive. The rare gases, on the other hand, are remarkably inert. He concluded that this behavior was due to a tendency on the part of the reactive elements to change their configurations in order to conform with those of the rare gases. Thus, an atom of potassium combines with one of chlorine by means of an electron transfer which results in the configuration of argon for each.

Potassium   Chlorine   Argon
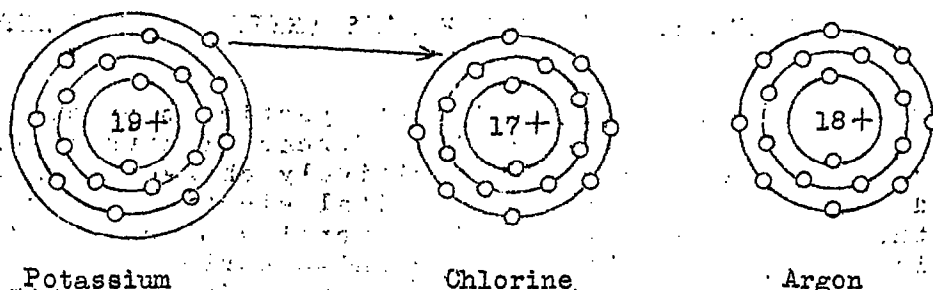
By means of this mutual claim on the shared electron
the two ions will remain closely associated with one another
as potassium chloride. This association can be interfered
with, however, as by solution in water, in which case the
potassium chloride will dissociate into chlorine as a nega-
tive ion and potassium as a positive ion. If the water is
removed by evaporation, these ions will aline themselves to
form a crystal lattice. In such a solid the attractive for-
ces between the oppositely charged ions except those on the
surface will be satisfied. However, in an amorphous solid
some of the attractive forces will not be satisfied because
of randomness of distribution of the ions.

2. Covalent Bonds

Compounds which are formed of atoms removed by three
places from the rare gases in the periodic table show a
greatly lowered tendency to ionize. Thus, ammonia and phos-
phine are only very slightly ionized. In many molecules it
is difficult or impossible to determine which atom is posi-
tive and which negative - for example, sulfur dioxide and
carbon dioxide and, still more strikingly, the diatomic
gases such as hydrogen and chlorine. These substances do
not ionize in solution.

In 1916, G. N. Lewis (reference 4) proposed that in
substances of this type it is possible for two atoms to
share electrons in such a way as to account for the stabil-
ity of each in attaining the rare gas configuration.
Langmuir suggested that this type of linkage be termed
"covalent."

a. True covalent bonds.- In a diatomic molecule such as
chlorine gas, each atom requires an electron to complete its

outer shell. In each atom the positive attraction of the
nucleus is equally great on each of the two negative charges
of the shared pair. This may be represented as follows:

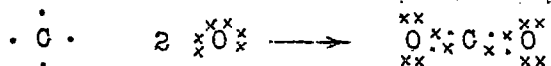$$:Cl \cdot \ + \ \times Cl \times \ \longrightarrow \ :Cl \times Cl \times$$
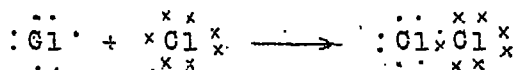
Such bonding is the most common form in organic molecules
and accounts for their complexities and magnitudes. Thus,
carbon has an outer shell of four electrons which it will
share with as many atoms as will contribute toward a stable
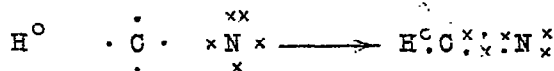structure of eight.

    1. Monavalent atoms: Carbon may share an electron with
          each of four hydrogen atoms to give the stable
          gas methane.

$$\cdot C \cdot \quad 4H^{\times} \longrightarrow \quad H \overset{\times}{\underset{\times}{C}} H \atop H^{H}$$
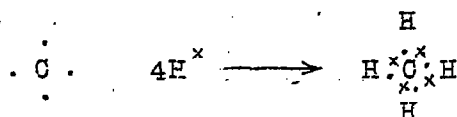
    2. Divalent atoms: Carbon may share two electrons with
          each of two oxygen atoms to give carbon dioxide.

$$\cdot C \cdot \quad 2 \ \overset{\times\times}{\underset{\times\times}{O}} \ \longrightarrow \quad \overset{\times\times}{\underset{\times\times}{O}} \overset{\times}{\underset{\times}{}} C \overset{\times}{\underset{\times}{}} \overset{\times\times}{\underset{\times\times}{O}}$$

    3. Trivalent atoms: Carbon may share three electrons
          with one nitrogen atom in a covalent bond, such
          as in hydrogen cyanide.

$$H^{\circ} \quad \cdot C \cdot \quad \times \overset{\times\times}{\underset{\times}{N}} \times \ \longrightarrow \ H \overset{\circ}{} C \overset{\times}{\underset{\times}{}} \overset{\times}{\underset{\times}{N}} \times$$

Carbon also has the ability to form covalent bonds with it-
self an almost infinite number of times. It is well estab-
lished that the structure of crystalline carbon (diamond) is
formed by single covalent bonds which accounts for its very
great stability.

    b. Coordinate covalent bonds.- Compounds exist the prop-
erties of which do not fit into any of the previously dis-
cussed categories. In 1892 Werner (reference 5) advanced a
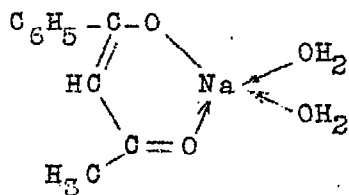theory to account for them. These substances, formerly

shelved under the name "molecular compounds," appear to result from the union of two or more saturated molecules. They are also apparently independent of the groups in the periodic table to which the atoms involved belong.

Because of its position in the periodic table sulfur can form only the two normal covalent bonds because this brings about the completion of its full complement of eight electrons. Of these eight, two are shared with other atoms, as in dimethyl sulfide. This compound can, however, be oxidized as follows:

$$H_3C : \overset{xx}{\underset{xx}{S}} : CH_3 \longrightarrow H_3C : \overset{O}{\underset{O}{\overset{xx}{\underset{xx}{S}}}} : CH_3$$
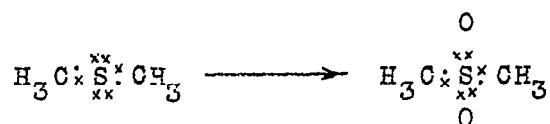
The two oxygen atoms have received two electrons each from the sulfur; thus their outer valence shells are complete, whereas the sulfur already had a saturated shell.

This same mechanism is used to explain another phenomenon occurring in organic molecules: namely, the chelate compounds. The peculiar properties of the hydrate of the sodium derivative of benzoyl acetone indicate that this substance may be represented by the following formula in which the arrow indicates that two electrons are contributed by each such oxygen atom.

$$
\begin{array}{c}
C_6H_5-C-O \\
\quad // \qquad \searrow \\
HC \qquad\qquad Na \overset{\nearrow}{\underset{\searrow}{}} \begin{array}{l} OH_2 \\ OH_2 \end{array} \\
\quad \searrow \qquad \nearrow \\
\qquad C = O \\
H_3C
\end{array}
$$

If this water were present as water of crystallization, the compound should have the same chemical properties as the anhydrous salt. The hydrate, however, dissolves in toluene; whereas the anhydrous salt is insoluble.

A similar example is given by the behavior of orthosubstituted phenols such as salicylaldehyde which form chelation compounds readily.
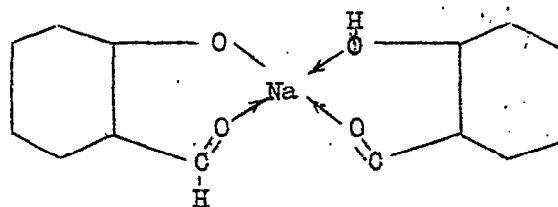
Further evidence indicates that the phenolic hydrogen
in salicylaldehyde is itself linked to the oxygen of the
aldehyde group in this same manner:
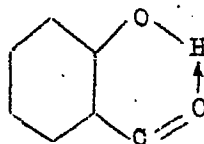
This leads to a very important case of this type of bonding:
namely, the formation of hydrogen bridges between molecules.
Many substances containing hydroxyl groups exhibit this phe-
nomenon and even water has been shown to have a trimeric
structure in ice.
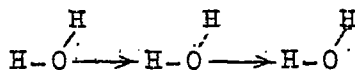
The fact that most molecularly associated substances contain
hydroxyl or related groups leads to the conclusion that this
type of bond may play a very important role in cohesive or
adhesive phenomena.

3. Metallic Bonds

The metals which comprise the greatest number of ele-
ments in the periodic table owe their unique properties to
a bond type which was not recognized until recently. Lorentz
(reference 6) first advanced the theory that a pure metal
consists of a crystalline arrangement of metallic cations
with free electrons moving in the interstices. In 1927,
Pauli (reference 7) postulated that these electrons exist in
a continuous set of energy levels. At absolute zero they

occupy the most stable levels in pairs with oppositely op-
posed spins so that they would be unavailable for orientation
in an applied magnetic field. As the temperature rises,
however, these stable pairs would be broken down as one elec-
tron rises to a higher energy level with the result that the
paramagnetic susceptibility of the mass would be raised un-
til finally a point is reached at which paramagnetic suscep-
tibility is independent of temperature.

If a simple metal such as the lithium crystal is con-
sidered, an arrangement of eight atoms is found at the cor-
ners of a cube. The distances of these atoms from one
another satisfy the crystallographers' requirement for a
single electronic bond. Other characteristics indicate the
existence of double electron bonds as well. The stability
of the structure may be explained on the basis of the theory
of resonance which has been applied to many types of struc-
tures in organic chemistry. It is the same concept which
explains the familiar Kekule structure of the benzene mole-
cule in which the double bonds are visualized
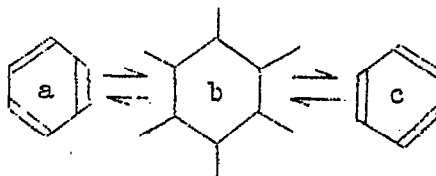
as alternating between the configurations (a) and (c) with
(b) as an intermediate.

Thus, any two atoms in a lithium crystal may be linked
by two electrons or by one electron at a given instant. The
single electron bonds are also used to account for the hali-
des of boron having structures which could be explained in
no other way. In effect the resonance between single and
double electron bonds is a very specialized case of covalent
bonds.

4. Van der Waals Forces

Up to this point the more potent forces of attraction
between atomic nuclei and orbital electrons have been dis-
cussed. All these interactions may be thought of in terms
of units of energy. These units, however, participate in
maximum and not total exchanges. When a bond is formed, the
positive and negative charges of the participating molecules

are not completely neutralized. There remain in many mole-
cules residual energies which are very nearly of stable
bond-forming magnitudes. These forces affect the melting
and boiling points of many substances.

Matter composed of both electrons and protons always
exerts attraction. A liquid will wet a solid surface to a
degree dependent upon the magnitudes of the attractive or
adhesive forces between the two substances and the cohesive
forces within each. In the case of a drop of mercury on a
glass surface, the cohesive forces within these two materi-
als is much greater than the adhesion between them; conse-
quently the mercury droplet almost forms a sphere, but there
is sufficient attraction to distort this shape.

Many substances which will react at higher temperatures
are attracted by Van der Waals forces at lower ones. It
will be seen later that these attractive forces initiate re-
actions by virtue of the fact that their magnitudes are po-
tent over greater distances than those of an electrostatic
nature which are responsible for bond formation.

It was in recognition of these facts that Van der Waals
presented his corrected version of the equation of state for
gases and means for calculating the magnitudes of these re-
sidual attractive forces for all substances. It has been
found that they are greater for the molecules of compounds
than for molecules of elements or inert atoms, thus showing
that unequal distribution accounts for a greater residual
force field and consequently the more asymmetric the molecule
the greater these values will be. This is a matter of great
importance in explaining adhesive and cohesive properties.

B. THE NATURE OF COHESION

The mechanism whereby molecules or atoms in homogeneous
matter are held together is known as cohesion. The physical
state as well as the mechanical properties of the material
depend upon the type and magnitude of its cohesive bonds.
The operational effects of such bonds have been investigated
by Lennard-Jones and coworkers (reference 8) by considering
the case of an external particle approaching a crystalline
surface. In such instances one of several phenomena may oc-
cur.

Chemical attraction.- If the particle is an ion, a di-
rect electrostatic force will be set up between the charges

on the approaching ion and the ions on the surface of the
crystal.

Polarization.

(a) Whether the particle is charged or not, an induced
     dipole will be set up in the atom or ion by the
     electric field of the crystal.

(b) If the particle is charged, it will polarize the
     ions in the crystal.

Attraction through Van der Waals forces.- Inasmuch as
attraction exists even between two so-called neutral atoms
(atoms of a rare gas), it is assumed that a similar attrac-
tion will be exerted between the crystal ions and the
charged or uncharged particle, quite apart from the effect
of their valency charges.

On the basis of this analysis, these investigators cal-
culated these effects between neon and a charged particle,
respectively, near the 100 plane (planes parallel to the
face) of a sodium fluoride crystal; and between argon and a
charged particle, respectively, near a potassium chloride
crystal. These calculations showed that the electrostatic
attractions fall off very rapidly as the distance from the
surface increases, but are very powerful within a short op-
timum range. The Van der Waals attractions, on the other
hand, have a much wider range, but are never as powerful as
the electrostatic attraction. The polarization forces never
become very great. These relationships are illustrated in
figure 1.

These forces, with different degrees of magnitude, are
responsible for the cohesion between ions, atoms, and mole-
cules of all forms of matter. On the basis of this evidence,
as well as the fundamental precepts of chemistry and physics,
it is possible to ascribe points of strength and weakness to
these forces in their cohesive capacity. The net effects of
these forces determine the gross mechanical properties of
all materials.

It must be realized, however, that the intrinsic
strength which is indicated for materials is rarely achieved.
When a test specimen of crystalline rock salt is broken in
tension, the breaking load is 0.4 kilogram per square milli-
meter; whereas the calculated tensile strength is 200 kilo-
grams per square millimeter. Joffe (reference 9) found,

however, that by surrounding the test specimen with hot water,
loads as high as 160 kilograms per square millimeter could be
obtained. He explained this on the ground that "premature"
failure is due to the presence of submicroscopic scratches or
fissures on the surface of the specimen, around which extreme-
ly high stresses may be concentrated. By removing these fis-
sures as they were formed - that is, by continually dissolving
away the surface - he was able to break the bonds along a
plane of the crystal and thus approach the theoretical strength.

The presence of these minute cracks has been proved (ref-
erence 10) by sputtering metallic films on crystalline sur-
faces which results in fine lines of the metal. The reason
for these cracks probably lies in the fact that ideal packing
in crystals does not exist due to greater electrostatic forces
within the substance than near the surface, thus strains are
set up which cause the surface atoms to rearrange with rela-
tive ease under an applied load.

A brief consideration of several types of materials will
serve to illustrate the behavior of the different cohesive
forces.

1. Crystalline Matter

The criterion of crystallinity is the regularity of the
arrangement of the atoms in a solid structure. Any atom in
a crystal is separated from its neighbors by the same dis-
tances and at the same angles as any other atom of the same
kind.

When a true crystal is subjected to a tensile stress it
will rupture along the line of least resistance. The struc-
ture of crystals has been well established by X-ray and chem-
ical studies. Hence, it is possible to identify the forces
which were overcome along the cleavage plane.

a. Covalent crystals.- In the crystals of nonmetallic
elements, single atoms share electrons with each other in
pairs. Since neither atom exerts a greater influence on the
bond than the other, a state of relative inertia exists. Two
factors determine the effect of these bonds in providing co-
hesive stability, the bond distances, and the bond angles.
The first of these factors determines the range over which
the attractive force acts and how much it is interfered with
by electrons closer to the nucleus of each atom. The second
determines the configuration of the crystal.

It has been shown that carbon is capable of forming
single, double, and even triple covalent bonds. That bond
angle influences the structure is shown by the properties of
diamond and graphite; whereas the effect of bond distance is
illustrated by comparing diamond and crystalline silicon.

Diamond is the hardest and most inert of all crystals.
It consists of carbon atoms joined to one another by primary
covalent bonds; thus at the end of each carbon tetrahedron
there is another carbon atom. There is relatively little
strain in such a crystal and the distances between each atom
and the next are relatively small. In the case of graphite,
on the other hand, each carbon atom is attached to three of
its neighbors instead of four, two through single bonds and
one through a double bond. The angle of the double bond is
quite different from that of the single. The result of this
arrangement is the formation of layers of two dimensional
plates which are rather loosely held by Van der Waals forces
in the crystal. That these Van der Waals forces are strong
enough to give some stability to the structure is to be ex-
pected from the fact that the energy of the double bond is
less than twice that of a single bond.

In crystalline silicon in which the atoms have the same
arrangement as in the diamond crystal, the bond distances
are greater and the bond energies are consequently less; thus
a weaker structure results.
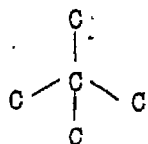
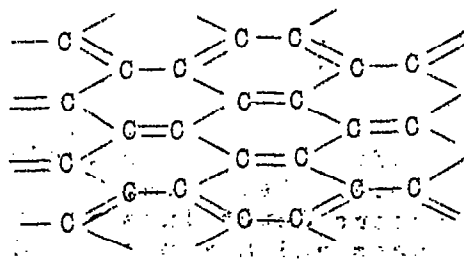(Diamond)
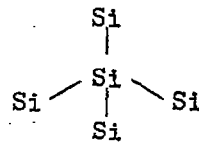
Bond distance = 1.54 Å
Bond energy = 58.6 k.cal./mol.

(Silicon)

Bond distance = 2.34 Å
Bond energy = 42.5 k.cal./mol.

(Graphite)
(single bond)   (double bond)

Bond distance = 1.54 Å and 1.34 Å
Bond energy = 58.6 and 100 k.cal./mol.

b. Ionic crystals.- Owing to the nature of ionic bond formation by the capture of an electron from an electropositive atom by an electronegative atom, the cohesive strengths of such crystals are weaker than those formed by covalent bonding. An ionic molecule splits into two fractions much more easily under the influence of chemical as well as physical forces. Thus, the solubilities are high and the strength properties low as compared to covalent substances. The same rules of bond distance and angles govern these strengths.

c. Coordinate covalent crystals.- The coordinate covalent bond has some of the properties of both ionic and covalent bonds. It has been called, in fact, the semipolar bond. The large groups of pure compound minerals are composed of complex crystals in which one molecular type is connected to another by the interlocking of their individual crystal lattices. Pauling (reference 1) has set forth several rules which apply to the types which are more ionic than covalent in character. These rules are based upon the concept that anions are coordinated at the corners of tetrahedral or polyhedral force distributions about each cation and that these polyhedra are joined at a corner, an edge, or a face. On this basis the formation and properties of such structures may be predicted as follows:

1. A coordinated polyhedron of anions is formed about each cation, the cation-anion distance being determined by the radius sum and the coordination number of the cation by the radius ratio.

2. In a stable ionic structure, the valence of each anion is exactly or nearly equal to the sum of the strengths of the electrostatic bonds to it from the adjacent cations.

3. The presence of shared edges, and especially of shared faces, in a coordinated structure, decreases its stability. This effect is pronounced for cations with large valence and small coordination number.

4. In a crystal containing different cations, those with large valence and small coordination number tend not to share polyhedron elements with one another.

These rules are so applicable to predominately ionic coordinate bonds that variance from them is a test of predominant covalency. All the forms of silica obey them, which proves the partially ionic nature of the Si O bond; whereas with sulfur, the SiS_4 tetrahedra share edges with one another to give infinite chains.
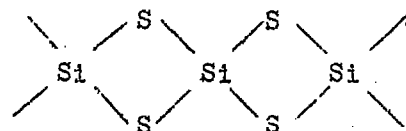
thus proving the Si-S bond to be essentially covalent.

  d. Crystals containing hydrogen bonds.- The phenomenon
of the hydrogen bond is responsible for the unusual proper-
ties of water. By analogy with other related compounds such
as H_2Te, H_2Se, and H_2S, on the basis of decreasing molecular
weights and Van der Waals forces, the melting and boiling
points of water would be expected to be about -100° and
-80° C, respectively.

  A good example of C-O---H bonding in crystals is given
by the two crystalline forms of oxalic acid. The alpha form
of this substance consists of plates and the beta form of
long chains.

alpha

beta
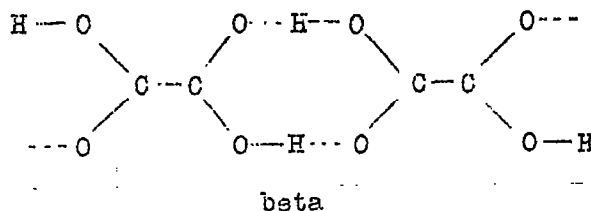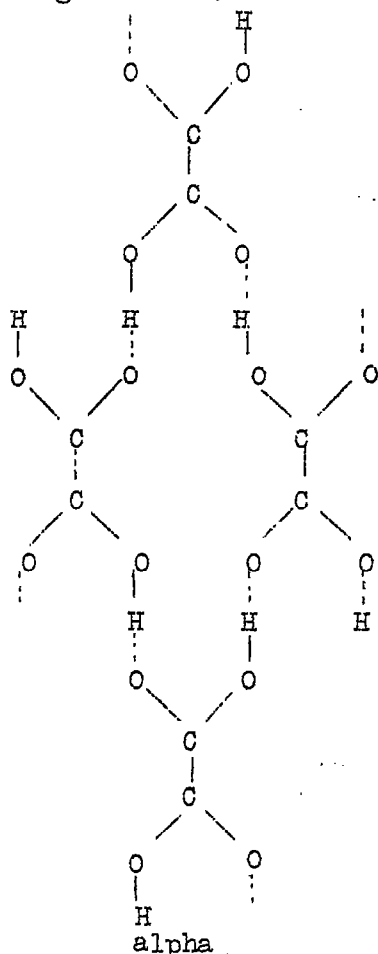
The plates and chains are interconnected through very weak Van der Waals forces.

e. Metal crystals.- The relationship between physical properties and bond distances and angles is the same in metal as in other crystals. If the atomic radii of the metallic elements are plotted against atomic number, it will be seen that a minimum occurs in each case between the sixth and tenth elements of each sequence. In this range, the greatest bond strength occurs and consequently the strongest metallic substances.

As the number of valence electrons per atom increases from 1 to 6, there is a corresponding increase in electron pairs effective in bonding the atoms together in the metal. Between the sixth and the tenth elements the number of electrons remains constant at about 6, but becomes smaller beyond the tenth. These relationships offer an explanation for the fact that properties dependent on cohesive forces, such as yield point and ultimate tensile strength and hardness reach maximimums between the sixth and tenth element in each sequence in the Periodic Table.

f. Van der Waals forces.- In crystalline substances the equilibrium of energies in the crystal lattice to give layers and threads (e.g., in graphite and asbestos, respectively) precludes the existence of very great bonding forces between these more or less saturated systems. That these forces do vary, however, is evidenced by the much greater interplanar cohesion for graphite than for oxalic acid or mica. These forces, therefore, depend on the crystalline configuration as well as the nature of the individual atoms involved.

2. Noncrystalline Matter

Most materials used for construction are not pure crystalline substances, but do have varying degrees of crystallinity. The cohesive behavior of amorphous substances may be explained on the basis of the more definite knowledge of crystal structure, inasmuch as the same forces hold them together.

a. Metals.- Most metals consist of isolated regions of crystallinity surrounded by an amorphous medium. Alloys exhibit the properties of the component parts except where true intermetallic compounds are formed. In the disordered amorphous regions of metals, the cohesion is due to Van der Waals

forces of high magnitude. This is merely another way of
stating that the attractive force does not reach the magni-
tude of a valence bond. When metals are cold drawn, however,
there is a much greater tendency toward crystalline lattice
formation with an accompanying increase in cohesive strength.

b. Glass.- Silicate glasses are the most common and
have been shown by Warren (reference 12) to consist of a
random network of silicon and oxygen atoms with each silicon
atom tetrahedrally bonded to four oxygen atoms (fig. 2). All
the oxygen atoms, however, are not bonded to silicon atoms;
thus interstices of varying sizes exist throughout the struc-
ture. When the composition of the glass is modified by al-
kali or alkaline earth metals, these interstices become more
numerous and each metal ion is surrounded by oxygen atoms
with unsatisfied charges and is consequently linked to these
through coordinate covalent attractive forces.

Glass structures, in general, are composed of oxides
such as SiO_2, B_2O_3, P_2O_5, Al_2O_3, and so forth, which are
known as network formers and oxides of alkali or alkaline
earth metals such as Na_2O and CaO, which are known as net-
work modifiers.

c. Wood.- The structure of wood is, as is true of most
complex natural materials, very imperfectly known. Predom-
inantly, it consists of long fibers of cellulose joined to-
gether by means of lignin. The structure of cellulose is
that of a chain composed of glucoside units linked to one
another through C-O-C bonds. Neighboring chains are intra-
molecularly held together by means of hydrogen bonds.
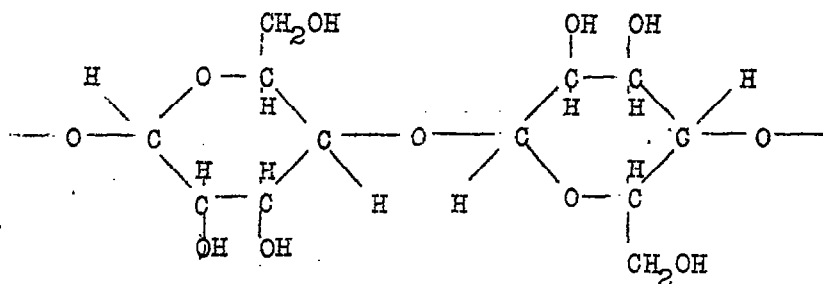
Lignin is not a single substance; its chemical nature varies
from species to species.

The bond between cellulose and lignin is in itself a problem of adhesion. Although the greatest strength of wood lies in the direction of the cellulose fiber, many of the properties of a given wood depend on the nature and amount of its lignin component.

    d. Natural and synthetic high polymers.- High polymeric materials include all substances which may be considered as consisting of large multiples of monomeric units, formed either by polymerization or condensation. Cellulose, rubber, and vinyl resins are examples of polymeric materials. There are two types of high polymeric compounds:

    Thermoplastic - two-dimensional molecules

    Thermosetting - three-dimensional molecules

These two classes of materials have arrangements somewhat analogous to those of asbestos and diamond, respectively.

    1. Thermoplastic polymers (reference 13).- If the attractive forces between chains are strong and the fine structure permits of easy lattice formation, a high degree of crystallinity and hence cohesion will result. Such materials fall in the fibrous area of figure 3. In fibers such as cellulose the individual chains are probably held together by means of hydrogen bonds through the OH groups. Other fibers of high strength, such as nylon, are probably joined by similar forces.

    The forces between molecules of polystyrene, polymethyl methacrylate, and related materials are not as great as those between cellulose and nylon molecules. These materials fall in the plastic area of figure 3. There are no very reactive centers, such as hydroxyl or amido groups for forming hydrogen bridges between chains. The most likely assumption to explain their strength in films, filaments, and so forth, is that they are held together by Van der Waals forces which are strong because of the great asymmetry of the monomer molecules. The vinyl polymers are not as asymmetric as polystyrene or methyl methacrylate and they tend toward rubbery characteristics.

    Rubbery materials owe their properties to very much weaker Van der Waals forces between the molecular chains. A tensile load applied to a rubber causes

an actual change in the configurations of the
chains; the coiled equilibrium state is changed
to the stressed chain state. These materials are
located in the rubbery area of figure 3.

2. Thermosetting polymers.- Cured thermosetting resin-
ous materials, such as phenol-formaldehyde and
urea-formaldehyde condensates, are composed of a
three-dimensional cross-linked network, analagous
to the diamond structure.

In order for such a structure to be formed, it is
necessary that at least one of the reactants in
the polymerization mixture have three or more ac-
tive centers at which bond formation can occur.
In phenol-formaldehyde resin, for example, the
benzene ring is capable of forming bonds at the
para and two ortho positions with respect to the
hydroxyl group. The cohesive forces in such a
material are very strong covalent bonds, and con-
sequently, the gross physical properties are
those of great strength and stability.

C. THE NATURE OF ADHESION

1. Theories Concerning Adhesion

The investigation into the nature of adhesion has as
its objective the establishment of the most desirable phys-
ical and chemical properties for an adhesive between two
given surfaces so that maximum structural strength can be
obtained. In the past two decades considerable interest has
been aroused in this subject. Probably the greatest effort
in this direction was that undertaken in Great Britain, the
results of which are described in the three reports of the
Adhesives Research Committee under the auspices of the
Department of Scientific and Industrial Research. The greater
part of this investigation was conducted by J. W. McBain and
coworkers (reference 14). At the same time, work was being
done in this country at the U. S. Forest Products Laboratory
by F. L. Browne and T. R. Truax. Both organizations were in-
terested in the mechanism whereby two surfaces of an adhesive-
ly formed joint are held by the adhesive.

McBain as a result of his investigations arrived at the
conclusion that two types of bonded joints may be formed:

Mechanical - between porous surfaces

Specific - between smooth, dense surfaces

Browne and Truax (see references 15 and 16), however, maintained that although some of the strength of the bond between two porous surfaces must be attributed to tendrils of adhesive which enter the pores, this mechanical interpenetration cannot account for more than a small fraction of the joint strength.

a. McBain's experimental work.- McBain drew his conclusions from the following experiments:

1. McBain prepared joints between surfaces of silver to silver and silver to wood. He varied the character of the silver surface by welding silver gauze at several points in single and double layers to the smooth surface and obtained qualitative results for the strength of bonds prepared with a proprietary gelatin glue:

Joint[1]	Strength	Remarks
1. Ag:glue:Ag	O	Glue film moist.
2. $(Ag)_g$:glue:$(Ag)_g$	O	Glue film moist.
3. Ag:glue:wood	O	Glue film only on wood when joint was broken.
4. $(Ag)_g$:glue:wood	Weak	Stronger than 3; glue film partly on silver gauze and partly on wood.
5. $(Ag)_{gg}$:glue:wood	Moderate	Stronger then 3 or 4; glue film partly on silver gauze and partly on wood.

[1]$(Ag)_g$ = Silver to which was welded one layer of gauze.

$(Ag)_{gg}$ = Silver to which was welded two layers of gauze.

Similar results were obtained using gum arabic and molten shellac, respectively, as adhesives.

2. Surfaces of hard and soft woods were treated with
three successive coatings of ebony stain before bonding and
the joint strengths were compared with those of unstained
surfaces by breaking manually. In the case of soft woods
the joints prepared with either the stained or the unstained
surfaces could not be broken by hand, but in the case of the
hardwoods, the stained joints broke. McBain concluded that
the stain was able to fill the pores of the hardwoods, but
not of the soft woods, thus preventing mechanical penetra-
tion by the glue of the hardwoods, which consequently gave
weak joints.

3. If adhesion to porous surfaces is mechanical, the
joint strength must be directly related to the tensile
strength of the glue. McBain, using the method of Farrow
and Swan (reference 17), prepared adhesive films by casting
on thinly greased ferrotype plates. Films and specimens of
bonded walnut wood prepared with a sodium silicate glue and
an animal glue, with and without the addition of dextrose,
respectively, had the following strengths:

Glue	Glue film in tension	Strength (psi) Walnut joints	
		Shear	Tension
1. Animal glue	12,000	1500	825
2. Animal glue mixed with an equal part of dextrose	Less than 1000	600	420
3. Sodium silicate	600	700	---

4. Specific adhesion requires wetting of the surface
not only by the solvent, but also by the glue. McBain at-
tempted to show that gelatin does not wet several porous
surfaces with which it forms strong joints. (See references
18 and 19.) To do this, he measured the water absorption of
filter paper, viscose rayon, and fused silica, and then meas-
ured the change in concentration brought about by the addi-
tion of these materials to aqueous solutions of glue. He
found that only with fused silica did the concentration be-
come lowered. This he interpreted as showing that water was
being removed from the solution by porous substances such as
filter paper and viscose rayon, but no glue was being ad-
sorbed.

5. McBain believed that if specific adhesion is opera-
tive, the attractive field of the solid surface should impose

an orienting influence upon the molecules of the very thin
adhesive layer. In such a case the glue structure should
differ in a glue line from that of a solid block of glue.
Studies of X-ray patterns from glue films on wood revealed
no such difference.

   b.Forest Products Laboratory experimental work.- Browne,
Truax, and other workers gave the following interpretation to
these experiments:

   1. Some degree of specific adhesion is a necessary pre-
requisite of mechanical adhesion in the case of materials
having such a fine degree of porosity as wood. Red oak sur-
faces, selected because of the large pores, were joined with
Lipowitz metal alloy (reference 16) which has a melting point
of 60° C, does not wet wood, and has a viscosity not unlike
that of woodworking glues. The joint was easily separated
by hand and the film was removed intact.

   Glue solutions contain considerable volumes of water or
other solvents. As the joint dries, the glue contracts
throughout its entire mass. If the interpenetrating tendrils
did not adhere tenaciously to the cell walls, they would
shrivel and the entire interface between wood and adhesive
would disintegrate. Photomicrographs of glued sections
showed that in all cases the glue had remained attached to
the cell walls and in drying had contracted from the center
of each tendril, leaving a hollow cylinder.

   2. In the staining of hard and soft woods prior to glu-
ing, the pine probably absorbed the oil stain more readily
than did the mahogany; thus enough of the surface of the pine
was unaffected to form a good joint. If sandpaper were used
to clean the stained mahogany surfaces the filled pores would
be unaffected; whereas cells of the wood would be exposed on
the surface to be bonded. McBain's experiment was repeated
using paraffin wax and collodion, respectively, to seal the
pores and the surfaces were sanded before gluing. Good
joints were obtained although penetration was greatly reduced
as evidenced by photomicrographs.

   3. McBain's relationship between the tensile strength
of glue films and the shear and tensile strength values of
glue joints was based on an experiment in which gluing meth-
ods assuming mechanical adhesion were used. Thus, the glue
was prepared in a thin solution, applied hot to heated wood
surfaces and pressed immediately in order to fill the wood as
much as possible with glue.

This experiment was repeated on several species of wood glued with sodium silicate, animal glue, and animal glue containing two concentrations of dextrose. The tensile strength of walnut joints, and the shear strength of maple joints glued with these substances is as follows:

Glue	Glue film in tension[a]	Wood joints	
		Shear[b]	Tension[c]
1. Animal glue	12,000	3950	1400
2. Animal glue-dextrose mixed (1:1)	Less than 1000	3350	1300
3. Animal glue-dextrose mixed (1:1.5)	----	3150	----
4. Sodium silicate	600	3000	950

[a]Values determined by McBain

[b]Maple block shear

[c]Walnut joints

In each case the glue was applied in concentrated solution to one surface and allowed to dry until the glue line retained a finger print and then assembled. The joints so obtained were much stronger than those of McBain. Although there is some loss in joint strength when the glue is weakened, this loss is not so great as indicated by McBain and, furthermore, the greater number of failures in these joints occurred in the body of the glue and not at the interface between the glue and the wood, so that the failure was not one of adhesion.

4. McBain's conclusion regarding the lack of adsorption of gelatin from aqueous solution is not necessarily correct. If water is more attracted to wood than is the gelatin, it will be selectively adsorbed from solution, thus giving the appearance of negative adsorption for gelatin.

Campbell (reference 20) has recently advanced the theory that glue is adsorbed to wood surfaces through a monomolecular layer of water which is directly attached to groups on both the wood and glue surfaces.

5. Although the Forest Products Laboratory workers did not comment on McBain's fifth experiment, later investigators studying the effect of surfaces on lubricant films have found that attractive forces between a surface and an adsorbed layer do not operate through much more than a monomolecular layer of the liquid. (See reference 21.) This is in agreement with the findings of Lennard-Jones (reference 8) who calculates the electrostatic attraction between surfaces and charged particles. In such a disorganized macroscopic system as an animal glue film it is not likely that orientation effects present in a monomolecular layer could be detected by the method used by McBain.

2. The Chemical Properties of Surfaces (reference 10)

It has been shown that adhesion to any porous surface is not primarily a mechanical phenomenon. Evidence is accumulating in every pertinent field that molecular attractive forces are responsible for the bond between any two surfaces. A knowledge of the chemical nature of surfaces is necessary in order to establish the type of bond formation which may occur.

The surfaces of solids are entirely different from their internal structures. The simple treatments of grinding and polishing differ very greatly in their effects on surface nature. In metals, especially, X-ray diffraction patterns show that grinding removes sections of the surface without appreciable distortion of the remaining crystal structure; whereas polishing removes the promontories and deposits materials from them in the crevasses, leaving a smooth transparent amorphous film known as the Beilby layer. This layer has more of the characteristics of a liquid than a solid and is much more reactive. If, for example, a metal vapor is condensed upon a polished metal surface, a crystal pattern is first obtained, but on standing this changes to that of a completely amorphous structure. If a nail is hammered into a crystalline surface, the amorphous ring around the hole will be more readily attacked by acids than the remainder of the surface. Glass surfaces when polished are rendered doubly refracting to a depth of 3000 angstrom units.

Solid surfaces are very irregular in their constitution. Thus, the surface of even a monocrystalline metal will contain different faces, edges, corners, and projections. For this reason, all parts of a given surface will not have the same catalyzing ability and consequently the same degree of

affinity for adhesive substances. Experiments show that dif-
ferent faces of the same crystal exert very different forms
of attraction upon dyes. Thus, if lead nitrate is immersed
in a solution containing methylene blue and picric acid, some
of the surfaces will be blue and some yellow; neither film is
contaminated with traces of the other dye.

The greater the activity a surface possesses, the more
likely it is to be contaminated with impurities, which are
present in the air. Freshly split mica surfaces will sieze
each other tenaciously, but if they are freely exposed to
circulating air currents they lose this activity after a few
minutes. It has been demonstrated that if these surfaces are
covered, they will retain their attraction for each other for
several days. Accidental traces of grease will greatly re-
duce the wetting properties of such surfaces and even slight
contamination will increase the contact angle with a liquid.

The purification of a surface is, consequently, of the
greatest importance if strong tenacious glue lines are to be
obtained. This is by no means a simple operation. It is
possible to clean the surface of glass by heating with a
flame for a short time, provided the contamination is not ex-
cessive, but this treatment cannot be applied to most other
surfaces as they would become sintered. Metals may be cleaned
with benzene or by slight etching with acids followed by wash-
ing with distilled water and drying with alcohol and ether.
It has been demonstrated experimentally at the Curtiss-Wright
Laboratories that sanding of wood surfaces with the finest
grade of sandpaper immediately before gluing gives a much
better bond than that obtained with glazed surfaces produced
by planing or with roughly sanded ones; thus the sanding op-
eration is one of cleansing.

3. The Mechanism of Adsorption

a. Adsorption phenomena, general.- Determination of the
heats of adsorption and chemical investigation of adsorbed
films on solid surfaces show that two distinct types of for-
ces are involved. When a gas is attracted to a surface by
means of Van der Waals forces, the heat of adsorption is 4000
calories per mole or less, and the variation of a few degrees
in temperature results in a simple pumping off of part of the
film. If, on the other hand, an actual covalent bond is
formed, as is the case with oxygen adsorbed on carbon, the
heat of adsorption will be of the order of 10,000 calories
per mole and may even reach as high a value as 200,000 calo-
ries per mole. In this latter case, the temperature required

to release the adsorbed film is sufficient to pyrolyze the
chemical bond. Very frequently this bond is stronger than
the cohesive bonds of the adsorbing material and the compound
formed between it and the gas is released as such; thus,
when oxygen is adsorbed on charcoal, heating results in the
liberation of carbon monoxide and carbon dioxide.

Depending on the temperature, the same gas may be ad-
sorbed by Van der Waals forces or by primary chemical forces.
Polanyi (reference 22) pointed out that the free valences of
a surface would not attract the impinging molecules of a gas
until these had surmounted a potential barrier. In other
words, only those molecules which have a certain energy val-
ue will combine chemically with the surface. This relation-
ship is well illustrated by the behavior of hydrogen on
nickel at various temperatures between -200° and 100° C at
different pressures. Thus, at 600 millimeter pressure the
curve of volume adsorbed plotted against temperature is given
in figure 4. (See reference 23.) At -190° to -180° C ad-
sorption takes place almost instantaneously through Van der
Waals forces. The amount of gas adsorbed decreased to a min-
imum at about -160° C because of the increase in kinetic
energy of the gas molecules. Above -160° C primary bond for-
mation begins to occur. Adsorption reaches a constant value
between -110° and 0° C. Further increase in temperature re-
sults in the pyrolysis of the chemical bonds.

b. Adsorption phenomena at glue lines.- It is evident
that the primary consideration in selecting a suitable adhe-
sive for a given surface is an evaluation of the relation-
ship between active groups on the molecules of the adhesive
and the surface. At the present time, the difficulties in-
volved in measuring the exact area of a solid surface and
the lack of knowledge with respect to the configurations,
molecular weights, and kinetic behavior of high polymeric
substances make it impossible to define mathematically the
total bond energy at a glue line interface. It should be
possible, however, to construct a theoretical picture of this
region which would lead to a better understanding of the phe-
nomenon of gluing.

1. Metal surfaces

(a) Metals to metals (direct).- The art of metal
bonding depends very greatly on the uses of solders and welds.
The chemistry of alloy formation furnishes considerable in-
formation on the nature of the attractive forces involved.
If two metals are very closely related - for example, copper

and gold atoms of the one will replace atoms of the other in
a crystal. When there are certain definite proportions —
for example, CuAu and Cu_3Au, the distribution in the crystal
will resemble that of an ionic compound such as NaCl. If
the metals are dissimilar they may actually form chemical
compounds which have their own crystal structure and have
chemical and physical properties which are quite different
from those of the constituent elements. Thus, the melting
points of sodium and mercury are 97.5° and -38.7° C, respec-
tively; whereas the substance Hg_2Na melts at 360° C.

Although the exact relationships which hold in the crys-
talline state are not exactly those obtained in a soldered
or welded joint, the same general laws apply. Thus, the ex-
perience with solders has been that the strongest and most
permanent bonds are formed between metals having optimum
chemical affinity. (See reference 24.) In all cases where
the metal surface remains solid, a good bond with the liquid
solder is best obtained when a wetting agent or flux is em-
ployed to cleanse the interface.

(b) Metals to enamels.- When metals are glazed with
vitreous enamels, it has been observed that the ground coat
between the metal and the glaze must contain cobalt or a
similar oxide. The role of the cobalt compound has been the
subject of much controversy, but a plausible theory is that
it serves as a catalyst in forming the bonds between atoms
of the metal and oxygen atoms which are attached to silicon
in the enamel. The interfacial bond between a vitreous and
a metallic surface, according to Weyl (reference 25) must be
of the chemical type in order to explain the stability of
such a system. King (reference 26) has reported that in the
case of good bonding between iron and enamels, atoms of iron
partially penetrate into the enamel in the form of dendrites
which remain attached to the iron surface.

(c) Metals to rubber.- It has long been known that
extremely good bonds are obtained by vulcanizing rubber onto
certain metallic surfaces. Evidence shows that the rubber
is actually attached to the surface through a sulfur bridge.
The bond is obtained more easily with brass than with iron
(reference 27), a fact which correlates with the greater ease
of the sulfide formation of copper and zinc than of iron.

(d) Metals to resinous adhesives.- An example of
primary bond formation between a resin and a metal surface
has been described by Doolittle and Powell. (See reference
28.) These workers developed a vinyl chloride-acetate co-
polymer resin VMCH for use as a metal lacquer by polymerizing

a small amount of maleic acid with resin, thus giving free
carboxyl groups on the chain ends of the polymer. The amount
of acid must be controlled to a small proportion, because 5
percent or over causes excessive corrosion of the metal. As
low as 0.1 percent, however, gives improved adhesion and the
optimum amounts are between 0.3 to 1.0 percent. That the
carboxyl group is responsible for adhesion was proved by
forming the sodium salt of the resin, thereby destroying its
adhesive properties. Diesters of the acid showed poor adhe-
sion, but monoesters were almost as effective as the acid
itself. This development is an excellent example of what
may be expected from a careful study of the chemical nature
of adhesion.

    In his work for the Adhesives Committee, McBain investi-
gated the adhesion of a large number of substances to metals.
He found a close relationship between the atomic volume of
the metal and the bond strength of a given adhesive. With
shellac, for example, there is almost a linear relationship
between atomic volume and tensile strength of the joint, as
shown by the following data:

Metal	Atomic volume	Tensile strength of shellac-glued joint (psi)
Nickel	6.7	3500
Copper	7.1	3300
Aluminum	10.1	2800
Tin	16.2	1100
Lead	18.2	600

Investigators at the Resinous Products and Chemical Company
have found that Redux joints are stronger with high valency
metals than with low, and that with different grades of steel
the adhesion is poorest with those which oxidize readily,
such as silicon steel.

    2. Wood surfaces

    (a) Wood to adhesives.- Adhesives for wood have been
more thoroughly investigated than for any other material.
The mechanism for the bond between wood and phenolic resins,
which is much stronger than the cohesive bonds of wood, is
very probably hydrogen bridging between hydroxyl groups in
the two materials. The reactivity of the phenolic hydroxyl
groups is indicated by the fact that water-insoluble phenol-
formaldehyde resin will dissolve readily in sodium hydroxide

solutions of moderate concentration and even the cured resin is attacked by strong alkaline solutions.

The probable structure of urea-formaldehyde resins indicates that much of their bonding power resides in the amido ($-NH_2$) and imido (=NH) groups which are present in large numbers in the uncured state. These groups will also participate in hydrogen bonding to other amido, imido, or hydroxyl groups. Campbell (reference 20) postulates that, instead of direct bonding to cellulosic hydroxyls, a molecule of water serves as an intermediary bonding material between wood and urea resins. The rapid failure of such structures when subjected to alternate wetting and drying was regarded as evidence of such bonding. Introduction of high-boiling water-insoluble alcohols into the adhesive mixture improved the resistance of the bond to delamination under the cycle conditions.

(b) Wood and metal to adhesives.- Most adhesives which form satisfactory bonds to metals are not suitable for bonding wood and vice versa. Several adhesives have been developed recently, however, which consist of combinations of rubbers with phenolic resins. The bonding is accomplished by heat, which cures the phenolic resin in a strong bond to the wood and the rubber to the metal.

It has been found by Cunneen, Farmer, and Koch (reference 29) that olefins form compounds with saligenin, which is the precursor of phenol-formaldehyde resin.

(Saligenin)   (Olefin)
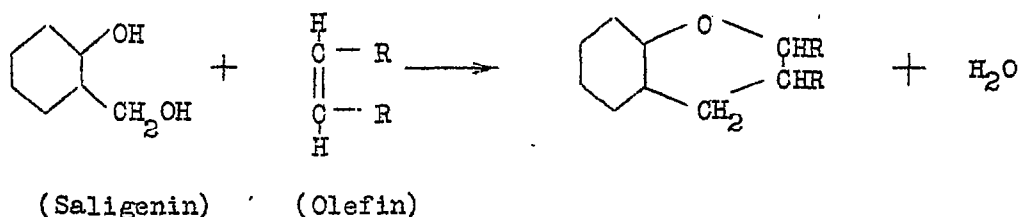
It has also been observed that an oxidized rubber reacts readily with maleic acid, phenol, and formaldehyde to give a modified rubber-phenolic resin. (See reference 30.)

A reaction between rubber and a curing phenolic resin probably occurs in this same manner, the terminal salegnin grouping of the resin attaching to the double bond in the surface molecules of the rubber. Thus a primary chemical bond would be formed, accounting for the high shear strength observed for these rubber-resin adhesives.

3. _Glass surfaces_.- The effect of cobalt oxide in bonding vitreous enamels to metal has already been mentioned. Stannous chloride is used to promote adhesion in plating silver and other metallic films on glass. The strength of the bond between sodium silicate and glass indicates that primary chemical bonds are involved.

4. _Rubber surfaces_.- Strong bonds may be obtained between rubber surfaces through Van der Waals forces as well as through chemical bonds. In the first case, a solution of rubber applied to a rubber surface leaves a fused structure which has good bond strength. In the second case, vulcanization proceeds across the interface of two rubber surfaces in the same manner as within the two original masses. This is evidenced by the bond strength of vulcanized patches on tires.

5. _Plastic surfaces_.- It has been found by Barkhuff and Carswell (reference 31) that a thermosetting resin cured at one temperature gives evidence of further cure at a higher temperature. This indicates that such a resin may frequently retain a degree of reactivity which would be sufficient for chemical reaction at the surface with a curing thermosetting adhesive. In the bonding of any resinous surface cured in a mold or between press platens, it is very important to remove any waxes used in their fabrication from the surface in order to permit adsorption of the adhesive material.

Thermoplastic materials are usually swelled or dissolved by organic solvents. Consequently, they may be bonded by the addition of a solvent which attacks both surfaces and allows an interdiffusion of the two materials. This permits the Van der Waals attractive forces to exert a maximum effect brought about through hydrogen bridges.

4. Fundamental Approaches to the Determination

of the Nature of Adhesion

a. _The Bartell cell_ (reference 32).- It has long been known that the affinity of a solid substance for a liquid was directly related to the shape of a drop of the liquid on a smooth surface of the solid. By measuring the angle of contact, it is possible to calculate the adhesion tension at the interface:

$$A_{1,2} = S_2 (\cos \theta) \quad \text{where} \quad \theta > 0 \qquad (1)$$

where

A   adhesion tension

S   surface tension

θ   contact angle

Subscripts

1   solid

2   liquid

This device is useful where the contact angle is finite, but for the purpose of a study of adhesives it is much more important to measure the attraction of a solid for liquids which form a contact angle of zero. In other words, the best adhesion is given by substances which have a greater adhesive attraction for the surface than cohesive attraction within themselves.

Bartell and coworkers have found that by using two immiscible liquids, one which wets the surface very well and one which wets it very poorly, it is possible to measure adhesion tension if several other values are known or can be calculated. This is based on the use of a displacement cell now known as the Bartell cell, which is shown in figure 5.

The solid substance is powdered to a uniform particle size carefully cleaned and dried and packed into the cell compartment by a special technique, such that two-thirds of the plug is saturated with the poorly wetting liquid and one-third with the liquid which is to be measured. The spaces between the powdered particles behave like minute capillary pores, the average radius of which may be determined by means of the formula for the rise of liquids in capillary tubes as well as by Poiseuille's formula for the rate of flow of liquids through capillary tubes. Values calculated by both of these methods check the pore size with a high degree of accuracy.

After packing the cell, the equilibrium pressure required to displace the poorly wetting liquid by the highly wetting liquid is measured. By means of the following formulas, the adhesion tension is calculated:

$$\cos \theta_{2,3} = \frac{981\ Pr}{2\ S_{2,3}} \tag{2}$$

$$A_{1,2} - A_{1,3} = \cos \theta_{2,3} \; S_{2,3} \tag{3}$$

$$A_{1,3} = \cos \theta_{1,3} \; S_3 \tag{4}$$

$$A_{1,2} = \cos \theta_{2,3} \; S_{2,3} + A_{1,3} \tag{5}$$

where

A   adhesion tension

P   displacing pressure

S   surface tension

θ contact angle

r   average pore radius

Subscripts

1   solid

2   highly wetting liquid

3   poorly wetting liquid

An example of such a calculation is given by solid carbon, carbon tetrachloride, and water (carbon = 1; carbon tetrachloride = liquid 2; water = liquid 3):

$\theta_{1,2} = 0^\circ$ $r = 9.3 \times 10^{-6}$ cm

$\theta_{1,3} = 40^\circ \; 35'$ $P_{2,3} = 6935$ g/cm^2

$S_{2,3} = 44.54$ dynes/cm $S_3 = 72.08$ dynes/cm

$$\cos \theta_{2,3} = \frac{6935 \times 981 \times 9.3 \times 10^{-6}}{2 \times 44.54} = 0.7103$$

$$A_{1,2} - A_{1,3} = (0.7103)(44.54) = 31.63 \text{ dynes/cm}$$

Adhesion tension water:carbon = $A_{1,3}$ = $(\cos 40^\circ \; 35')(72.08)$
$$= 54.74 \text{ dynes/cm}$$

Adhesion tension CCl_4:carbon = $A_{1,2}$ = 54.74 + 31.63 = 86.37 dynes/cm

A possible means for attacking the problem of adhesion
of high polymers to solid surfaces would be the measurement
of adhesion tension values of polymers of low molecular
weight. Thus, monomeric vinyl acetate and pure fractions of
several polyvinyl acetates of low molecular weight may estab-
lish a useful relationship between adhesiveness and polymer
size.

b. Heat of wetting (reference 33).- When a solid is im-
mersed in a liquid it may or may not be dissolved, but in
either event a heat change occurs. The heat liberated in
the latter case is known as the heat of immersion or wetting
and is directly related to the energy of attraction between
the two substances. Harkins and coworkers have devised a
calorimetric method for measuring this heat and the results
have been applied in the paint and varnish industry in se-
lecting suitable vehicles for pigment particles.

c. Heat of formation.- In the investigation of the nature
of adhesion, the heats of formation of chelate compounds as
well as ion exchange reactions of certain groups such as hy-
droxyl and carbonyl should throw some light on the strength of
bonds involving such groups. Phenolic resins remove anions
from water by exchanging hydrogen for the anion on the hydrox-
yl group. This takes place readily with sodium and should
bear some relation to the heat of reaction of sodium phenolate,
resorcinate, and so forth. Although unmodified phenolic res-
ins are poor adhesives for metals, because of incompatible
physical properties, they do form such strong bonds to steel
molds that the removal of a molded object may be effected
only when waxes are used to prevent bond formation.

II. PROPERTIES OF ADHESIVELY BONDED STRUCTURES

A. PHYSICAL STRENGTH OF BONDS

1. Mechanical Behavior Phenomena

It has been previously shown that high polymers consist
of a weblike distribution of molecules which, in addition to
being mechanically intertwined, are attracted to one another
by forces ranging from weak Van der Waals forces to strong
chemical bonds. Any high polymer at a given temperature will,
consequently, be either rigid or soft, depending on the magni-
tude of these bonds. There is a definite temperature for each

substance below which it is appreciably more rigid than it
is above that temperature. This point is known as the tran-
sition point and is a characteristic of materials bonded by
Van der Waals forces.

When a high polymer is placed under a given stress it
will suffer a deformation, the extent of which depends on
the temperature and the amount and rate of loading. The de-
formation may be resolved into three components. (See refer-
ence 34.)

a. Ordinary elastic deformation (d_{OE}).- The individual
links in the chain molecule may be stretched by altering the
bond angle under an applied load.

$$d_{OE}$$

The forces required to bring about such a strain are very
high, being of the order of Young's modulus for metals. Thus
may be defined a modulus of elasticity (G_{OE}) for this process
which has a magnitude of 10^4 to 10^6 kilograms per square cen-
timeter. Such a deformation will appear or vanish immediately
as the load is applied or released. It is completely inde-
pendent of temperature.

b. Highly elastic deformation (d_{HE}).- A chain molecule
has considerable length with respect to molecular dimensions
and the single covalent bonds do not prevent free rotation
of the atoms in the chain. Consequently, the maximum possi-
ble distance between ends of a carbon chain is never reached
in equilibrium. It seems most likely that the chain is more
or less coiled along its entire length and the distance be-
tween ends will have a definite range for a given kinetic
energy of the molecule. In order to increase the distance
between the ends of these molecules, it is necessary that a
distorting load be sufficient to uncoil the chain. In addi-
tion to the energy required for uncoiling, some energy must
be expended in overcoming the attractions between points
along the chain and similar points on neighboring molecules.
This latter effect accounts for the fact that this process
is temperature dependent.

The modulus of elasticity (G_{HE}) for a material which may
be distorted by this process is of the order of 10 to 100

kilograms per square centimeter, and very great distortions
are obtained; rubber, for example, may be extended 1000 per-
cent. Once the load is removed the coiling process will be-
gin, but requires time to reach equilibrium. This equilib-
rium is attained by simple revolution of the atoms about the
single bonds and by overcoming attractive neighboring forces
which retard the process.

c. Viscous deformation (d_{visc}).- Above the transition
temperature a thermoplastic material will be principally dis-
torted by separation of the molecular chains. This means
that the kinetic energy of chain motion is sufficient to
overcome the Van der Waals side forces, thus allowing the
molecules to be drawn along each other without a greatly re-
tarding friction. This process is also time dependent, the
rate of flow depending on the difference between the experi-
mental temperature and the transition point.

d. Deformation equation.- The total distortion of a ma-
terial exhibiting all these characteristics may be repre-
sented by the following diagram:
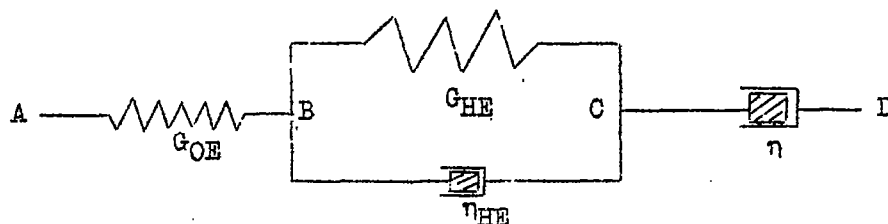
Each element in the diagram will be displaced to an extent
dependent on the load. The increase in distance between A
and D under a given load is the total distortion for that
load. Thus, there may be written:

d_{OE} increase in distance   AB

d_{HE} increase in distance   BC

d_{visc} increase in distance   CD

This process has been represented mathematically by
Alexandrov and Lazurkin (reference 35) and modified by Simha
(reference (36) as follows:

$$D(t) = d_{OE} + d_{HE}(\infty) \left[1 - \exp\left(-\frac{t}{\lambda}\right) + \frac{t\tau}{\eta} \right] \qquad (1)$$

The total deformation (D) is expressed as a function of rate of loading, and as the sum of the three types of deformation already discussed. The significance of each of these elements is as follows:

1. Ordinary elasticity

$$d_{OE} = \text{ordinary elastic deformation}$$

$$= \frac{\tau}{G_{OE}}$$

where

G_{OE} ordinary shear, tension, or compression modulus of elasticity

τ stress

2. High elasticity

$$d_{HE}(\infty) = \text{ultimate high elastic deformation}$$

$$= \frac{\tau}{G_{HE}}$$

where

G_{HE} modulus of high elasticity

This factor is modified by the exponential term which expresses the dependency on rate of loading and the viscous element.

t time elapsed between start of loading and the instant of observation, rate of loading being constant

$$\lambda = \frac{\eta_{HE}}{G_{HE}}$$

η_{HE} the viscous effect associated with the highly elastic deformation

3. Viscosity.- The final term expresses the deformation
brought about by the viscous flow of the material modified
by the rate of loading.

This equation for the deformation of high polymers is
only a first approximation. Other expressions have been de-
veloped, based on thermodynamics, which involve considera-
tions of crystallization phenomena. It is expected that fur-
ther developments in the interpretation of mechanical behav-
ior of high polymers will materially contribute to a better
understanding of glue line phenomena.

2. Effect of Thickness of Glue Line on Strength

a. Experimental evidence.- An investigation of several
adhesives for wood by Poletika (reference 37) reveals that
joint strength is inversely proportional to the thickness of
the glue line.

Glue layer thickness (in.)	Number of samples	Average shear strength (psi)	Average wood failure (percent)
0.002	5	1500	37
.003	5	1330	40
.004	11	1450	25
.005	17	1410	22
.006	6	1340	21
.007	7	1150	29
.008	8	1100	19
.009	10	1180	11
.010	9	1200	9
.011	6	900	12
.012	7	940	11
.013	7	920	6
.014	4	840	4
.015	5	850	4
.016	3	670	5
.017	4	790	3
.018	4	480	2
.019	2	560	5
.020	1	520	3

However, starved joint formation will occur if too little
adhesive is applied to porous surfaces and would result in
a weak joint because of lack of film continuity.

Similar relationships were found by Crow (reference 38)
in a study of soft soldered joints. He found that, by making
the film very thin, joint strengths as high as 11 tons per
square inch were obtainable. This value is several times the
tensile strength of the solder.

b. Probability of flaws.- The relationship between aver-
age strength and rod or fiber length has been discussed by
Peirce (reference 40) for cotton, Bellinson (reference 41)
for rayon, and Anderegg (reference 42) for glass. If a fiber
10 inches in length is broken, the rupture will occur at the
weakest spot. If another fiber exactly like the first is
divided into ten 1-inch lengths and each of these is broken,
a range of breaking loads will be obtained, the lowest being
equal to the one obtained on the first fiber. Thus, the
shorter the specimen the less will be the probability that it
will contain the weakest spot. This same analogy can be ap-
plied to glued joints; the average strength of 10 thin ones
should be greater than that of one ten times as thick.

To test this assumption, Bikerman (reference 39) pre-
pared joints between brass blocks and steel cylinders with
paraffin wax. He controlled the thickness of the wax film
in each joint so that 100 joints were obtained having thick-
nesses of approximately 57 μ and 40 of approximately 540 μ.
The operational variables were minimized by preparing 10 thin
joints and 4 thick joints in 10 successive groups. The ten-
sile load was applied by suspending gram weights from the
samples. The results of these tests are as follows:

Strength of Paraffin Wax Joints
(kg/cm²)

Group of specimens	57 μ			540μ
	Maximum	Mean	Minimum	Mean
1	35.0	27.5	18.0	17.5
2	35.0	29.5	20.0	15.5
3	32.0	26.0	20.5	16.5
4	31.0	25.0	18.5	14.5
5	25.5	22.0	17.0	13.0
6	32.0	24.5	19.5	18.0
7	28.0	22.5	14.5	13.0
8	29.5	23.5	20.5	13.0
9	28.5	23.0	16.5	14.5
10	29.5	22.5	17.0	13.0
Average	30.6	24.6	18.20	14.85

The average value obtained for the thin joints compares
with the value of 18 kilograms per square centimeter for par-
affin to brass obtained by McBain and Lee. (See reference
14.) The tensile strength of paraffin measured by
Konstantinova (reference 43) is 7.45 kilograms per square
centimeter and for joints thinner than 0.01 millimeter, 14.8
kilograms per square centimeter. McBain and Lee obtained
the following values for varying thicknesses of shellac
joints; these show similar relationships to Bikerman's values:

	Strength of Joints (kg/cm^2)		
Joint	Thin 57 μ	Thick 540 μ	Ratio thin/thick
Al:shellac:Al	145.0	75.0	1.93
Ni:shellac:Al	190.0	110.0	1.73
Brass:paraffin:steel	24.6	14.8	1.67

Bikerman analyzed his data by means of a simple applica-
tion of probability theory as follows:

Let m = number of specimens of length 1
     n = number of specimens of length 1/n

If it is assumed that the probability of finding a weak spot
is a function of length, one in n of the thin joints will
contain the weak spot which would have caused the failure of
the thick joint. The tensile strength of this joint would
accordingly be identical with that of the thick joint. If
this reasoning is correct, the low values in each batch of
the paraffin joints of 57 μ thickness should not differ sig-
nificantly from the average values of those of 540 μ thick-
ness.

The difference between the low values of the thin joints
and the average values of the thick joints was found to be
significant, but the probability theory accounts for approx-
imately two-thirds of the difference in strength. This is
shown as follows:

Let m = number of values
     t = a measure of the significance of the difference
     $x_1, x_2, x_3 \ldots x_{10}$ = the differences in the same group
                        between the minimum values of
                        the thin joints and the average
                        values of the thick joints

and x = the difference between the total averages for
        the minimum values of the thin joints and the
        average values of the thick joints

Then   m = 10

        x = 18.20 - 14.85 = 3.35

and $t = x \sqrt{m(m-1)}/\left[(x_1-x)^2 + (x_2-x)^2 + \ldots + (x_{10}-x)^2\right]^{\frac{1}{2}}$

        = 5.1

Since, when m = 10, only one value of t in 100 will exceed
3.25 by chance, the difference between the low values for the
thin joints and the average values of the thick joints is
significant. The discrepancy between these values is ex-
plained by Bikerman as due to crystallization differences in
the thick and thin sections of wax.

c. Surface smoothness.- In order to obtain a strong
joint, a smooth surface is more desirable than a roughened
one, inasmuch as the depressions in the roughened one must be
filled in addition to the gap between the two surfaces. Fur-
thermore, if the surface is deeply scored, there is always a
possibility that air bubbles will be trapped in the glue line.
The existence of such points of interfacial discontinuity will
cause high concentrations of stresses in their vicinity which
will result in premature failure of the entire bond when ex-
ternal loads are applied.

d. Effect of curing conditions.- When a thermosetting
resin adhesive is used, it is cured in the joint with pressure
and very frequently with heat. Thus, it reaches an equilib-
rium state under an abonrmal set of conditions. When the
pressure and heat are released, the resin has a tendency to
reach an equilibrium at a lower pressure and temperature, but
is restrained by its bond to two surfaces. This results in a
stress at the glue line. If the glue line is very thin,
these stresses will be very small with respect to the bond
strength and the glued joint will be able to support much
higher loads. Similar stresses are set up in adhesive films
which are formed by evaporation of solvent.

3. Problem of Thermal Expansion Differences

Inorganic materials such as glass and metals are charac-
terized by relatively low coefficients of thermal expansion;
whereas organic materials in general have high thermal expan-
sion coefficients. Hence, stresses are developed in joints

prepared with these two types of materials when the temperature differs appreciably from that at which the bond was formed. If the molecular cohesion of one of the materials is sufficiently low, the stresses developed at the glue line can be relieved by flow. However, such materials usually undergo excessive flow at temperatures above the softening point and have poor bond strengths. For materials which have high molecular cohesion and hence undergo very little flow, such as the thermosetting resins or most materials at low temperatures, the stresses developed because of different thermal expansion coefficients are not readily relieved by molecular flow.

For the latter type of material it is necessary to add an ingredient to the adhesive to adjust its thermal expansion coefficient to approximately that of the adherend. Investigations at the National Bureau of Standards (reference 44) have shown that this can be achieved by the addition of inorganic powdered materials to the adhesives. This may be illustrated by the adjustment of the thermal expansion coefficient of polystyrene to that of brass.

Pure polystyrene has a thermal expansion of $70 \times 10^{-6}/^{\circ}C$; whereas that of brass is $17 \times 10^{-6}/^{\circ}C$. When brass inserts are placed in pure polystyrene, very small changes in temperature cause the plastic to crack and become detached from the metal. If 11 percent aluminum oxide, having an expansion coefficient of $8.7 \times 10^{-6}/^{\circ}C$, is added to the polystyrene, cracking does not occur over a wide temperature range and the bond remains intact.

This same principle is frequently employed in the use of carbon black in rigid adhesives. Carbon has a very low expansion coefficient (5.4×10^{-6}). When 10 percent is added to phenol-formaldehyde resin, the coefficient of expansion is 20 percent less than that of the pure resin. Equations for calculating the composition of adhesive mixtures required to obtain a desired thermal expansion coefficient are given in references 44 and 45.

B. TEST METHODS FOR BOND STRENGTHS

Comparatively little work has been done on the development and standardization of testing methods for determining the fundamental physical properties of adhesively bonded joints. The American Society for Testing Materials has

recently organized Committee D-14 on Adhesives to formulate
methods of tests pertaining to adhesives. The cooperative
efforts of the members of this committee should contribute
to a better understanding of the problems involved in test-
ing adhesively bonded joints and should provide a basis for
obtaining uniform test data for bonds formed between the
many available varieties of adhesives and adherends.

Some of the testing methods which have been used or pro-
posed for the determination of bond strengths will be briefly
reviewed to complete this survey on adhesives and adhesion.

1. Tensile Strength

A method for the determination of the tensile strength
of glued joints based on experimental work at the Bell
Telephone Laboratories (reference 46) has been prepared for
consideration by the Subcommittee on Strength Properties of
A.S.T.M. Committee D-14 on Adhesives. This method provides
for the type of specimen shown in figure 6 and specifies that
self-alining grips shall be employed in order to assure
loading exactly normal to the glued surfaces.

2. Shear Tests

In the testing of glued joints in shear it is very dif-
ficult to attain pure shear conditions. A variety of methods
have been proposed for the determination of this property.
The block shear joint test and the plywood joint test are
currently used in Army-Navy Aeronautical specifications.
These and other proposed shear tests for glued joints are in-
cluded in the following summary of such tests.

a. Block shear (reference 47).- The block shear test is
the method most widely used for evaluating the bonding
strength of adhesives to wood. The specimen and shearing
tool are shown in figure 7. The specimen is broken by the
application of a compressive load.

b. Plywood shear (reference 47).- The plywood shear test
specimen consists of a three-ply wood laminate in which the
grain of the center ply is at right angles to the two face
plies. The specimen is prepared by milling a groove two-thirds
through the core on each of the face plies. The specimen is
broken under a tensile load in special grips as shown in fig-
ure 8.

c. Single-lap joint shear (reference 48).- The single lap joint specimen has been widely used for the measurement of adhesion to metals. The specimen is broken under a tensile load. Standard grips for tensile specimens are used. The specimen is shown in figure 9.

d. Double lap joint shear (reference 48).- The double lap joint specimen was developed for the purpose of overcoming the unequal distribution of stresses encountered in the single lap joint specimen, and is broken in the same manner. The specimen is shown in figure 9.

e. Scarf joint shear (reference 48).- The scarf joint specimen is difficult to prepare, but the shearing stresses developed in the glue line are more uniform than for any other type of shear test. If the two adherends are of equal modulus, the single scarf joint is adequate. For materials of unequal modulus, however, it is necessary that the angle taper of each be proportional to its modulus, thus necessitating a double scarf joint. These joints are illustrated in figure 9. The specimens are broken under a tensile load.

f. Cylindrical single shear (reference 14).- The cylindrical single shear test was used by McBain to reduce the amount of wood failure in the glue line. The grips and specimen are shown in figure 10. By means of a special adjustment it is possible to vary the angle θ shown in the figure. It was found that the most reproducible values were obtained when θ = 60°. The specimen is broken under a compressive load.

g. Johnson double shear.- The Johnson shear test is performed with the specimens and shearing tool shown in figure 11. It consists in rigidly clamping the outer sections of the specimen in the shearing tool and applying a compressive load upon the shear member which applies an evenly distributed load to the central portion of the specimen. It is necessary that the two glue lines be accurately placed in the shearing planes of the instrument; thus very careful machining of the specimen is required for reproducible values.

The cylindrical double shear test used by McBain (reference 14) is similar to the Johnson shear test. The essential difference is that the cylindrical specimen is broken by a tensile load. The grips and specimen for this test are shown in figure 12.

h. Discussion of shear tests.- Each of these tests has

disadvantages; some give poor reproducibility and others require a high degree of accuracy in machining. The reasons for poor reproducibility may be illustrated by considering the single lap joint specimen. It has been shown (reference 49) that stresses applied to such a specimen are not equally distributed over the entire glue line, but are concentrated near the ends of the overlap. This is illustrated in figure 13.

This unequal stressing is due to the shape of the test piece rather than the means for applying the load. A given load will be concentrated excessively at the ends of each member on the overlap and very slightly on the exact center of the glued area. The result will be a partial shear failure and a partial peeling action. The shear value obtained in this way will not be directly proportional to the area of the overlap, but will reach a maximum value after which increasing the area will not change the shear value.

De Bruyne has found, however, that by tapering the ends of the overlapped sections, the shear value will become proportional to the area. A comparison of shear breaking loads obtained by these two methods is presented in figure 14.

It is shown in figure 9 that a similar modification of the double lap joint eliminates even more of the distortional error.

Shear methods based on torsion have not been investigated to any extent. These methods are also hampered by the problem of nonuniform stress distribution over the entire glued area. A rigorous consideration of the stress problems in shear testing has been presented by Goland and Reissner (reference 50), and also by Hearmon (reference 51).

National Bureau of Standards,
      Washington, D. C., February 23, 1945.

III. BIBLIOGRAPHY

A. LITERATURE REFERENCES IN TEXT OF REPORT

1. Pauling, Linus: The Nature of the Chemical Bond.   Cornell
       Univ. Press (Ithaca), 1939.

2. Sidgewick, N. V.:   The Electronic Theory of Valency.
       Oxford Univ. Press (London), 1932.

3. Kossel, W.:   Über Molekülbildung als Frage des Atombaus.
       Ann. der Physik., vol. 49, 1916, pp. 229-362.

4. Lewis, G. N.:   The Atom and the Molecule.   Jour. Am. Chem.
       Soc., vol. 38, 1916, pp. 762-785.

5. Werner, H.:   Beitrag zur Konstitution anorganischer Verbin-
       dungen.   Zeit. für anorg. Chem., vol. 3, 1893, pp. 267-330.

6. Lorentz, H. A.:   The Theory of Electrons.   G. E. Stechert
       and Co. (New York), 1909.

7. Pauli, W.:   Über Gasentartung und Paramagnetismus.   Zeit.
       für Phys., vol. 41, 1927, pp. 81-102.

8. Lennard-Jones, J. E., and Dent, B. M.:   Cohesion at a Crystal
       Surface.   Trans. Far. Soc., vol. 24, 1928, pp. 92-108.

9. Joffé, A. F.:   Mechanical and Electrical Strength and Cohe-
       sion.   Trans. Far. Soc., vol. 24, 1928, pp. 65-72.

10. Adam, N. K.:   The Physics and Chemistry of Solids.
       Oxford Univ. Press (London), 1941.

11. Desch, C. H.:   The Chemistry of Solids.   Cornell Univ. Press
       (Ithaca), 1934.

12. Warren, B. E.:   Summary of Work on Atomic Arrangement in
       Glass.   Jour. Am. Ceram. Soc., vol. 24, 1941, pp. 256-261.

13. Mark, H.:   Intermolecular Forces and Mechanical Behavior of
       High Polymers.   Ind. Eng. Chem., vol. 34, 1942, pp. 1343-
       1348.

14. McBain, J. W., et al.:   Reports 1, 2, and 3 of the
       Adhesives Research Committee.   H. M. Stationery Office
       (London), 1922, 1926, and 1932.

15. Browne, F. L., and Brouse, D.: Nature of Adhesion between Glue and Wood. Ind. Eng. Chem., vol. 21, 1929, pp. 74-79.

16. Browne, F. L., and Truax, T. R.: The Place of Adhesion in the Gluing of Wood. Colloid Symposium Monograph, vol. 4, 1926, pp. 258-269.

17. Farrow, F. D., and Swan E.: The Absorption of Water by Dried Films of Boiled Starch. Trans. Text. Inst., vol. 14, 1923, pp. 465-474.

18. Bakr, A. M., and King, J. E.: The Determination of the Sorption of both Solvent and Solute. Part I. Preliminary. The System: Benzene-Iodine-Charcoal. Trans. Chem. Soc., vol. 119, 1921, pp. 454-460.

19. Bakr, A. M., and McBain, J. W.: The Sorption of Toluene and Acetic Acid and Their Mixtures by Carbon. Jour. Am. Chem. Soc., vol. 46, 1924, pp. 2718-2725.

20. Campbell, W. G.: Chemical Factors Involved in the Gluing of Wood with Cold-Setting Urea-Formaldehyde Glues. Rep. No. 3, Dept. Sci. and Ind. Res., Forest Prod. Res. Lab., 1943.

21. Bulkley, R.: Viscous Flow and Surface Films. Nat. Bur. of Standards Jour. Res., vol. 6, 1931, pp. 89-112.

22. Polanyi, M.: Betrachtungen über den Aktivierungsvorgang an Grenzflächen. Zeit. Elektrochem., vol. 35, 1929, pp. 561-567.

23. Benton, A. F., and White, T. A.: Adsorption of Hydrogen by Nickel at Low Temperatures. Jour. Am. Chem. Soc., vol. 52, 1930, pp. 2325-2336.

24. Pell-Walpole, W. T., Prytherch, J. C., and Chalmers, B.: An Investigation of the Factors Governing the Adhesion of Tin-Base Bearing Metals. Jour. Inst. Metals, vol. 68, 1942, pp. 217-256.

25. Weyl, W. A.: The Replacement of Oxygen in Glass and Its Effect on Adherence. Glass Ind., vol. 23, 1942, pp. 135-137, 152.

26. King, R. M.: Adherence of Glass to Metals. Glass Ind., vol. 23, 1942, pp. 421-423, 440.

27. Messenger, T. H.: Adhesion of Rubber to Metal. India-
    Rubber Jour., vol. 102, 1941, pp. 439-440.

28. Doolittle, A. K., and Powell, G. M.: New Vinyl Resin
    for Air-Dry and Low-Bake Coatings. Paint, Oil, and
    Chem. Rev., vol. 107, 1944, pp. 9-11, 40.

29. Cunneen, J. I., Farmer, E. H., and Koch, H. P.: Rubber,
    Polyisoprenes, and Allied Compounds V; The Chemical
    Linking of Rubber and Other Olefins with Phenol-
    Formaldehyde Resins. Jour. Chem. Soc., Oct. 1943,
    pp. 472-476.

30. Redfarn, C. A., and Schidrowitz, P.; British Patent
    507,995, June 23, 1939. Chem. Abstracts, vol. 34, no.
    2, 1940, p. 547.

31. Barkhuff, R. A., and Carswell, T. S.: Physical Structure
    of Phenoplasts. Ind. Eng. Chem., vol. 36, 1944, pp.
    461-466.

32. Bartell, F. E., and Osterhof, H. J.: Determination of
    the Wettability of a Solid by a Liquid. Ind. Eng.
    Chem., vol. 19, 1927, pp. 1277-1280.

33. Harkins, W. D.: Intermolecular Forces and Two-Dimensional
    Systems. Surface Chemistry. Pub. No. 21, Am. Assoc.
    for the Advancement of Sci. (Washington), 1943, pp.
    40-87.

34. Tuckett, R. F.: The Softening of Thermoplastic Polymers.
    Part I. Theoretical. Trans. Far. Soc., vol. 39, 1943,
    pp. 158-167.

35. Alexandrov, A. P., and Lazurkin, J. S.: Study of Polymers;
    Highly Elastic Deformation in Polymers. Acta Physicochim.,
    (U.R.S.S.), vol. 12, 1940, pp. 647-668.

36. Simha, R.: Elasticity and Flow in High Polymers. Ann.
    N. Y. Acad. Sci, vol. 44, 1943, pp. 297-312.

37. Poletika, N. V.: Effect of Glue Layer Thickness on Strength
    of Bonded Wood Joint. Rep. No. WE-170-M-2; Curtiss Wright
    Corp., Res. Lab., Nov. 1943.

38. Crow, T. B.: Some Properties of Soft Soldered Joints.
    Jour. Soc. Chem. Ind., vol. 43, 1924, pp. 65T-68T.

39. Bikerman, J. J.: Strength and Thinness of Adhesive
    Joints. Jour. Soc. Chem. Ind., vol. 60T, 1941, pp.
    23-24.

40. Peirce, F. T.: Some Problems of Textile Testing. Jour.
    Text. Inst., vol. 18T, 1927, pp. 475-489.

41. Bellinson, H. E.: Stress-Strain Properties of Viscose
    Rayon. The Effect of Changing Specimen Length.
    Text. Rec., vol. 61, Sept. 1940, pp. 38-42.

42. Anderegg, F. O.: Strength of Glass Fiber. Ind. Eng.
    Chem., vol. 31, 1939, pp. 290-298.

43. Konstantinova, W. P.: Über die Festigkeit mit der Zwei
    feste Phasen an ihrer gemeinsamen Grenzfläche aneinander
    haften. Acta Physicochim. (U.R.S.S.), vol. 1, 1934,
    pp. 286-295.

44. Turner, P. S.: The Problem of Thermal-Expansion Stresses
    in Reinforced Plastics. NACA ARR, June 1942.

45. Turner, Philip S., Doran, Jewel, and Reinhart, Frank W.:
    Fairing Compositions for Aircraft Surfaces. NACA TN
    No. 958, 1944.

46. A.S.T.M. Committee D-14 on Adhesives, Subcommittee I on
    Strength Properties, Tentative Method of Test for
    Tensile Properties of Adhesives: Aug. 28, 1944.

47. Army-Navy-Civil Committee on Aircraft Design Criteria:
    Wood Aircraft Inspection and Fabrication. ANC-19.
    Dec. 20, 1943.

48. Jackson, C. C.: Joints-Lap, Efficiency, Graphical Study
    of Physical Factors. Chrysler Engineering Laboratories,
    Rep. No. 4904, Feb. 1943.

49. De Bruyne, N. A.: The Strength of Glued Joints. Aircraft
    Engineering, vol. 16, 1944, pp. 115-118.

50. Goland, M., and Reissner, E.: The Stresses in Cemented
    Joints. Jour. Appl. Mech., vol. 11, 1944, pp. A17-A27.

51. Hearmon, R. F. S.: Significance of Coupling between
    Shear and Extension in the Elastic Behavior of Plywood.
    Proc. Phy. Soc., vol. 55, 1943, pp. 67-80.

B. REFERENCES TO OTHER PERTINENT LITERATURE

1. Technical Publications

a. Mechanism of Adhesion:

1. DeBruyne, N. A.: The Nature of Adhesion. Aircraft Eng.,
    vol. 18, 1939, pp. 51-54. C. A., vol. 34, no. 9, 1940,
    p. 2674.

2. Maslovskii, V. A., and Popova, T. N.: Adhesive Properties
    of SKB Solutions. Kozhverno-Obuvnaya Prom., vol. 16,
    1937, pp. 28-30. C. A., vol. 34, no. 10, 1940, p. 3398.

3. Krotova, N. A.: Cementing Ability of Natural and Synthetic
    Rubbers and their Cohesive and Adhesive Properties.
    Caoutchouc and Rubber (U.R.S.S.), vol. 8, 1940, pp. 28-
    37. C.A., vol. 35, no. 2, 1941, p. 654.

4. Becker. W.: Bituminous Binding Agents. Kolloid-Z, vol.
    92, 1940, pp. 382-384. C. A., vol. 35, no. 3, 1941,
    p. 884.

5. Markevitch, I. T.: Solutions of Fractions of Synthetic
    Rubber. Colloid Jour. (U.R.S.S.), vol. 6, 1940, pp.
    367-372. C. A., vol. 35, no. 9, 1941, p. 3123.

6. Selden, G. D., and Prutton, C. F.: Factors Affecting the
    Adhesion of Paint Films on Metals. Nat. Paint, Varnish
    Lacquer Assoc., Sci. Sec., Cir. no. 604, 1940, pp. 501-
    528. C. A., vol. 35, no. 10, 1941, p. 3459.

7. Goto, M., Asada, H., and Okomoto, T.: Investigation on
    the Mechanism of the Cementation of Metals. Rep. Aero.
    Res. Inst., Tokyo Imperial Univ., vol. 15, 1940, pp.
    431-476 (English). C. A., vol. 35, no. 11, 1941, p. 3574.

8. Zimmer, F.: Industrial Metals, Their Properties and Their
    Behavior as Surfaces for Lacquering. Z. Metall-u.
    Schmuckwaren-Fabrikat, Verchrom., vol. 20, 1939, p. 245.
    C. A., vol. 35, no. 13, 1941, p. 4323.

9. Smith, E. A.: Some Characteristics of Metal Surfaces.
    Machinery, vol. 57, 1941, pp. 541-544. C. A., vol. 35,
    no. 13, 1941, p. 4323.

10. Stamm, A. J., and Seborg, R. M.: Resin Treated Laminated
    Compressed Wood. Trans. Am. Inst. Chem. Engineers, vol.
    37, 1941, pp. 385-398. C. A., vol. 35, no. 16, 1941,
    p. 5668.

11. Hull, A. W., et al.: Glass to Metal Seals. Jour. Appl.
    Phys., vol. 12, 1941, pp. 698-707. C. A., vol. 35,
    no. 21, 1941, p. 7667.

12. Grader, R.: Reason for Increased Adhesivity of Bituminous
    Binders Caused by Montan Wax. Asphalt u. Teer Strassen-
    bautech., vol. 40, 1940, pp. 117-119. C. A., vol. 35,
    no. 21, 1941, p. 7678.

13. Pearce, W. T.: Acrylic Resins. Paint Ind. Mag., vol. 56,
    1941, pp. 422-424. C. A., vol. 36, no. 3, 1942, p. 849.

14. Singleterry, C. R.: Microscopic Observations on the Bond-
    ing Zone of Paper Coatings. Paper Trade Jour., vol.
    113, no. 18, 1941, pp. 37-40. C. A., vol. 36, no. 3,
    1942, p. 901.

15. Kleinert, H.: The Adhesivity of Bitumen Emulsions.
    Asphalt Teer Strassenbautech., vol. 41, 1941, pp. 5-8,
    19-22, 29-31. C. A., vol. 36, no. 12, 1942, p. 3650.

16. Salchow, W.: Vacuum Adhesion. Gelatine, Leim, Klebstoffe,
    vol. 8, 1940, pp. 27-29. C. A., vol. 36, no. 16, 1942,
    p. 4748.

17. Birinberg, M. L., and Sorokina, M. F.: Filling Metal Sur-
    faces before Painting. Khim. Referat. Zhur., no. 7,
    1940, p. 101. C. A., vol. 36, no. 19, 1942, p. 5757.

18. Butterworth, B.: Adhesion and Adhesives with Special Refer-
    ence to Anti-Scatter Treatments for Windows. Chem. and
    Ind., 1942, pp. 339-341, 350-351. C. A., vol. 36, no.
    20, 1942, p. 6267.

19. Clark, J. d'A.: The Measurement and Influence of Bonding
    between Paper Fibers. Paper Trade Jour., vol. 116,
    1943, pp. 29-35. C. A., vol. 37, no. 8, 1943, p. 2177.

20. Genir, G.: A New Process for Obtaining More Secure Adhe-
    sion between Rubber and Aluminum. Industrie Chemique,
    vol. 28, 1941, pp. 266-267. C. A., vol. 37, no. 18,
    1943, p. 5619.

21. Saal, R. N. J.: Introduction to the Theory of Adhesiveness.
    Kautschuk, vol. 18, 1942, pp. 109-111. C. A., vol. 37,
    no. 19, 1943, p. 5801.

22. Kerr, R. W., and Trubell, O. R.: Spectrophotometric Anal-
    yses of Starches. Paper Trade Jour., vol. 117, 1943,
    pp. 25-28. C. A., vol. 37, no. 22, 1943, p. 6926.

23. Buchan, S.:   Bonding of Rubber to Metals.   Trans. Inst.
       Rubber Ind., vol. 19, 1943, pp. 25-38.   C. A., vol. 37,
       no. 22, 1943, p. 6932.

24. Van Roy, L.:   The Theory of Adhesion.   Paper Ind., vol.
       25, 1944, p. 1102-1104.

25. Havens, G. G.:   Metlbond - A Metal Adhesive for Aircraft.
       Mech. Eng., vol. 66, 1944, pp. 713-714, 736.

26. Havens, G. G., and Ford, R. D.:   Plastic-Base Cements
       Alter Bonding Technique.   Plastics, vol. 1, no. 4, 1944,
       pp. 51-53, 96-97.   C. A., vol. 38, no. 20, 1944, p. 5615.

    b. Physical and Chemical Properties:

 1. Moore, R. J., et al.:   Measurement of Adhesion of Dried
       Coatings.   Am. Paint. Jour., Convention Daily, vol. 24,
       1939, pp. 18, 19, 20-21, 22-23.   C. A., vol. 34, no. 2,
       1940. p. 646.

 2. Earnest, E. C. M., and Pettifor, C. B.:   Adhesion in Ply-
       wood. Wood, vol. 4, 1939, pp. 65-66.   C. A., vol. 34,
       no. 4, 1940, p. 1097.

 3. Campins, F. C.:   Properties of Adhesives Related to Paper
       Surfaces.   Paper Trade Jour., vol. 110, no. 8, 1940,
       pp. 120-122.   C. A., vol. 34, no. 9, 1940, p. 3087.

 4. Weyl, A. R.:   Inspection of Plywood for Aeroplanes.   Wood,
       vol. 5, 1940, pp. 190-193.   C. A., vol. 34, no. 21,
       1940, p. 7568.

 5. Armbruster, F.:   Technical Specifications for Synthetic
       Resin Plywoods.   Kunststoffe, vol. 30, 1940, pp. 58-62.
       C. A., vol. 34, no. 22, 1940, p. 8105.

 6. Brouse, D.:   Some Causes of Warping in Plywood and Veneered
       Products.   Wood Products, vol. 45, no. 10, 1940, pp. 23-
       25, 27-29.   C. A., vol. 35, no. 1, 1941, p. 295.

 7. Gorina, A. I.:   Adhesives from Synthetic Rubber.   Caoutchouc
       and Rubber (U.R.S.S.), vol. 8, 1940, pp. 37-38.   C. A.,
       vol. 35, no. 2, 1941, p. 655.

 8. Hubbard, P.:   Adhesion of Asphalt to Aggregates in the Pres-
       ence of Water.   Proc. Highway Res. Board, vol. 18 I, 1938,
       pp. 238-249.   C. A., vol. 35, no. 4, 1941, p. 1202.

9. Kaplunov, Ya. N., and Bemshtein, Z. B.: Determination of
       the Adhesive Properties of Casein Shoe-Sole Pigments.
       Koshvenno-Obuvnaya Prom. (U.R.S.S.), vol. 19, no. 7,
       1940, pp. 12-14. C. A., vol. 35, no. 5, 1941, p. 1665.

10. Klibinskaya, E.: Composition of Cement for Binding Porce-
       lain to Porcelain. Keram. Sbornik, vol. 1, 1939, pp.
       51-52. C. A., vol. 35, no. 8, 1941, p. 2688.

11. Brown, D. S.: The Relation of the Strength Properties of
       Multiple Paperboard to the Bonding between Plies. Tech.
       Assoc. Papers, vol. 23, 1940, pp. 143-154, C. A.,
       vol. 35, no. 9, 1941, p. 3086.

12. Matthaes, K.: Application of Testing Methods in Airplane
       Construction. Testing of Paint and Varnish Materials.
       Paint Varnish Production Mgr., vol. 21, 1941, pp. 79-80.
       C. A., vol. 35, no. 11, 1941, p. 3835.

13. Neumann, E.: Determination of the Adhesivity of Bitumen
       on Mineral Aggregates. Bitumen, vol. 10, 1940, pp. 100-
       103. C. A., vol. 36, no. 1, 1942, p. 241.

14. Haufe, K.: The Adhesivity of Seam Fillers. Bitumen, vol.
       10, 1940, pp. 103-105. C. A., vol. 36, no. 1, 1942,
       p. 242.

15. Blok, A.: Some Peculiarities of Sovoprene, Caoutchouc,
       and Rubber (U.R.S.S.), vol. 8, 1939, pp. 87-88. C. A.,
       vol. 36, no. 5, 1942, p. 1522.

16. New York Paint and Varnish Production Club: Quantitative
       Adhesion Measurement of Coatings before and after
       Exposure. Nat. Paint, Varnish Lacquer Assoc., Sci. Sec.,
       Circ. no. 629, 1941, pp. 341-348, C. A., vol. 36, no. 8,
       1942, p. 2433.

17. Garukhina, Z. N.: Determination of the Gluing Properties
       of Rubber-Resin Adhesive. Khim. Referat. Zhur., no. 3,
       1940, pp. 122-123. C. A., vol. 36, no. 9, 1942, p. 2643.

18. Shishkov, V. P., and Moskov, T.: The Physical-Mechanical
       Properties and Chemical Stability of Some Phenol-Aldehyde
       Resins. Khim. Referat. Zhur., vol. 6, 1940, pp. 122-123.
       C. A., vol. 36, no. 16, 1942, p. 4930.

19. Smith, A. K., and Max, H. J.: Soybean Protein. Adhesive
       Strength and Color. Ind. Eng. Chem., vol. 34, 1942, pp.
       817-820. C. A., vol. 36, no. 16, 1942, p. 4931.

20. Azam, M. A.: Loss of Strength of Laminates on Prolonged
        Heating. Plastics Trends, vol. 2, 1942, pp. 7-8.
        C. A., vol. 36, no. 17, 1942, p. 5283.

21. Knight, A. G.: Waterproof Glues. Wood, vol. 7, 1942,
        pp. 109-112. C. A., vol. 36, no. 17, 1942, p. 5285.

22. Bigelow, M. H.: Urea Plastics. Prod. Eng., vol. 13, 1942,
        pp. 93-96. C. A., vol. 36, no. 18, 1942, p. 557.

23. Wegelius, E.: Pressed Plywood. Its Technical Use for
        Aircraft. Chem. Zentr., no. II, 1940, p. 1093. C. A.,
        vol. 36, no. 18, 1942, p. 5582.

24. Halls, E. E.: Polyvinyl Acetate Adhesives. Plastics,
        vol. 6, 1942, pp. 183-186. C. A., vol. 36, no. 19,
        1942, p. 5916.

25. Kühl, H.: Methods of Increasing the Adhesiveness of Starch
        Paste. Farben - Ztg., vol. 45, 1940, p. 825. C. A.,
        vol. 36, no. 21, 1942, p. 6836.

26. Barr, J. S.: Uses and Properties of Acidproof Cements.
        Chem. and Met. Eng., vol. 49, no. 10, 1942, pp. 96-99.
        C. A., vol. 37, no. 1, 1943, p. 245.

27. Wells, S. D.: Effect of the Adhesive Used in the Fabrica-
        tion of Corrugated Fiberboard on the Strength and Ser-
        viceability of Corrugated Fiber Boxes. Fibre Containers,
        vol. 24, 1939, no. 10, pp. 8, 12, 14, 16; no. 11, pp. 8,
        12, 14. C. A., vol. 37, no. 1, 1943, p. 256.

28. Wells, S. D.: Relative Strengths of Corrugated Fiberboards
        Fabricated with Various Adhesives under Various Condi-
        tions of Relative Humidity. Fibre Containers, vol. 25,
        no. 7, 1940, pp. 24, 26, 30, 32, 34. C. A., vol. 37,
        no. 1, 1943, p. 256.

29. Friedman, A.: Cemented Strength of Acrylic Cements.
        Plastic Trends, vol. 2, no. 6, 1942, p. 6. C. A., vol.
        37, no. 1, 1943, p. 1977.

30. Hoppler, F.: The Rheological Behavior of Cemented Adhesives.
        Gelatine, Leim, Klebstoffe, vol. 9, 1941, pp. 109-113.
        C. A., vol. 37, no. 9, 1943, p. 2487.

31. Klinov, I. Ya.: Non-Metal Materials as Substitutes for Non-
        Ferrous Metals and Their Alloys. Vestnik Inzhenerov
        Tekh., 1940, pp. 528-532. C. A., vol. 37, no. 12, 1943,
        p. 3529.

32. Knight, A. G.: Waterproof Glues. Wood, vol. 7, 1942,
        pp. 109-112. C. A., vol. 37, no. 13, 1943, p. 1528.

33. Horst, W.: The Flow Properties of Adhesives for Roofings
        and Joinings. Mitt. Dachpappen-Ind., vol. 14, 1941,
        pp. 163-178. C. A., vol. 37, no. 16, 1943, p. 4874.

34. MacDermot, J. G.: Aircraft Glues. Construction Glues,
        vol. 1, no. 4, 1942, p. 3. C. A., vol. 37, no. 20,
        1943, p. 6055.

35. Rammer, H. L.: Developments in the Manufacture of Solid
        Fiber Weatherproof Cases. Pacific Pulp Paper Ind.,
        vol. 17, no. 8, 1943, pp. 13-16. C. A., vol. 37, no.
        21, 1943, p. 6456.

36. Watts, V. E.: New Products for the Boxboard Industry.
        Pacific Pulp Paper Ind., vol. 17, no. 8, 1943, pp. 17-
        18. C. A., vol. 37, no. 21, 1943, p. 6456.

37. Walton, W. T.: Kem-pol. Properties, Characteristics,
        and Applications. Rubber Age, vol. 53, 1943, pp. 234-
        239. C. A., vol. 37, no. 21, 1943, p. 6493.

38. Grinsfelder, H., and Collins, M. R.: Plywood Bonding.
        Ind. Eng. Chem., vol. 36, 1944, pp. 152-157. C. A.,
        vol. 38, no. 6, 1944, p. 1297.

39. Perry, T. D.: Plywood for War. Chem. Eng. News., vol.
        22, 1944, pp. 700-705. C. A., vol. 38, no. 13, 1944,
        p. 3388.

40. Klingstedt, F. W.: Chemical Stability of Veneer Wood.
        Chem. Zentr., no. I, 1943, pp. 466-467. C. A., vol.
        38, no. 13, 1944, p. 3465.

41. Dietz, A. G. H., and Grinsfelder, H.: Behavior of Syn-
        thetic Phenolic-Resin Adhesives in Plywood under Alter-
        nating Stresses. Trans. A.S.M.E., vol. 66, 1944, pp.
        319-328. C. A., vol. 38, no. 14, 1944, p. 3747.

42. Knight, R. A. G.: Weathering Quality of Plywood Glues.
        Wood, vol. 9, 1944, pp. 136-140. C. A., vol. 38, no.
        18, 1944, p. 5023.

c. Working Properties:

1. Sauer, E., and Aldinger, W.: Surface Tension and Foam
      Formation in Glue Solutions. Kolloid-Ztg., vol. 88,
      1939, pp. 329-340. C. A., vol. 34, no. 2, 1940, p. 65.

2. Krasovskii, S. P.: Laminated Plastic with Plywood Base.
      Khim. Referat. Zhur., vol. 2, no. 3, 1939, pp. 122-123.
      C. A., vol. 34, no. 4, 1940, p. 1094.

3. Perry, T. D.: Resin Bonding without Hot Presses. Hardwood
      Record, Special Issue, 1939, pp. 12, 16. C. A., vol.34,
      no. 4, 1940, p. 1095.

4. Trevor, J. S.: Manufacture and Uses of Impregnated and
      Compressed Wood. Wood, vol. 5, 1940, pp. 59-60. C. A.,
      vol. 34, no. 10, 1940, p. 3466.

5. Nisnevich, E. A., and Bermon, D. Ya.: Cementing Rubber
      Soles. Russ., vol. 56, 1939, p. 138. C. A., vol. 34,
      no. 10, 1940, p. 3538.

6. Chater, W. B., and Chater, W. J. B.: Graphic Method of
      Determining Melting Points of Glue. Jour. Intern. Soc.
      Leather Trades Chem., vol. 24, 1940, pp. 190-199.
      C. A., vol. 34, no. 17, 1940, p. 6123.

7. Berkness, J. R.: High Frequency Method in Gluing and Dry-
      ing Wood. Wood Products, vol. 45, no. 9, 1940, pp. 12-
      14. C. A., vol. 34, no. 21, 1940, p. 7568.

8. Herman, A., and Knowlton, F. M.: Method for Inspection
      and Control of Liquid Starch-Base Adhesives for Bottle
      Labeling and Case Sealing. Proc. Am. Soc. Testing
      Materials, Preprint, no. 87, 1942. C. A., vol. 37, no.
      7, 1943, p. 1805.

9. Levin, A. Ya.: A Rapid Method for Determining the Con-
      centration of Volatile Substances in Rubber-Resin
      Adhesives. Khim. Referat. Zhur., vol. 4, no. 1, 1941,
      p. 87. C. A., vol. 37, no. 10, 1943, p. 2682.

10. Levigurovich, A., Seregin, A., and Sumkin, V.: Reducing
      the Consumption of Solvents in Gutta-Percha Adhesives.
      Chem. Zentr., no. I, 1942, p. 1838. C. A., vol. 37,
      no. 12, 1943, p. 3631.

11. Stephan, J. T.: One Method of Determining Required Pressure for Cold-Setting Resin Glues in Aircraft Assemblies. Construction Glues, vol. 1, no. 5, 1942, p. 4. C. A., vol. 37, no. 20, 1943, p. 6055.

12. Eilertsen, L. W.: Assembly Time in the Gluing Operation. Construction Glues, vol. 1, no. 6, 1942, p. 3. C. A., vol. 37, no. 20, 1943, p. 6056.

13. Smith, W. T.: Correction of Surface Defects in Plywood Finishing. Wood Products, vol. 48, no. 7, 1943, pp. 26, 28, 30. C. A., vol. 38, no. 3, 1944, p. 653.

d. Adhesive Materials (General).

1. Tsretkov, V. N.: Adhesives from Raw Materials in U.R.S.S. Khim. Referat. Zhur., vol. 2, 1939, p. 105. C. A., vol. 34, no. 3, 1940, p. 105.

2. Foulon, A.: Synthetic Resin Adhesives. Nitrocellulose, vol. 10, 1939, pp. 221-223. C. A., vol. 34, no. 6, 1940, p. 1773.

3. Horwitz, S.: Synthetic Glues in Veneer and Plywood Industry. Wood, vol. 5, 1940, pp. 4-7. C. A., vol. 34, no. 6, 1940, p. 1773.

4. Ohl, F.: Cementing Materials for Synthetic Materials and Metals. Oberflächentech., vol. 17, 1940, pp. 43-44. C. A., vol. 34, no. 16, 1940, p. 5565.

5. Light, L.: Laminated Textile Fabrics. Textile Weekly, vol. 25, 1940, pp. 131-132. C. A., vol. 34, no. 17, 1940, p. 6083.

6. Beacher, C.: Artificial Resins in Adhesives. Seifensieder. Ztg., vol. 67, 1940, pp. 97, 107, 117, 127, 137-138. C. A., vol. 34, no. 18, 1940, p. 6384.

7. Küch, W.: Progress in Use of Artificial Resin Adhesive. Luftwissen, vol. 5, 1938, pp. 427-431. C. A., vol. 34, no. 21, 1940, p. 7479.

8. Maslovskii, V. A.: New Shoe Cements. Kozhvenno-Obuvnaya Prom. (U.R.S.S.), vol. 19, no. 1, 1940, p. 18. C. A., vol. 35, no. 5, 1941, p. 1543.

9. Strong, R. K., and Tator, K.: Solvents for Adhesives.
   Chem. Ind., vol. 48, 1941, pp. 330-333. . C. A., vol.
   35, no. 9, 1941, p. 3003.

10. Hayward, C. H.: Synthetic Resin Glues. Wood, vol. 6,1941,
    pp. 213-215. C. A., vol. 35, no. 21, 1941, p. 7578.

11. Sanderson, J. McE.: The Varied Applications of Synthetic
    Resins. Paint, Oil Chem. Rev., vol. 103, no. 12, 1941,
    pp. 14-16, 18. C. A., vol. 35, no. 22, 1941, p. 8140.

12. Friebe, K.: Notational Refinement of Glues in Wood Working.
    Farben-Ztg., vol. 46, 1941, pp. 384-385. C. A., vol. 36,
    no. 4, 1942, p. 1110.

13. Perry, T. D.: Resin Adhesives Give Impetus to Improved Ply-
    wood Machinery. Wood Products, vol. 47, no. 4, 1943,
    pp. 33-34, 36-38. C. A., vol. 36, no. 11, 1942, p. 3291.

14. Perry, T. D.: The Uses of Plywood in Aircraft. Aero.
    Digest, vol. 41, no. 1, 1942, pp. 200, 205-206. C. A.,
    vol. 36, no. 21, 1942, p. 6698.

15. MacDermot, J. G.: The Use of Glue in Wooden Aircraft.
    Aero. Digest, vol. 41, no. 1, 1942, pp. 186, 267-270.
    C. A., vol. 36, no. 21, 1942, p. 6698.

16. Wilke, A.: Binding Agents in the Manufacture of Fiber-
    boards. Bull. Inst. Paper Chem., vol. 13, 1942, pp. 182-
    183. C. A., vol. 37, no. 4, 1943, p. 1039.

17. Spink, L.: Adhesives for Articles Made from Artificial
    Resins. Chem. Zentr., no. I, 1942, p. 3262. C. A.,
    vol. 37, no. 13, 1943, p. 3853.

18. Hebberling, H.: The Future of Substitutes. Farben. Chem.,
    vol. 12, 1941, pp. 29-31. C. A., vol. 37, no. 21, 1943,
    p. 6369.

19. Hadert, H.: Calcium Carbide as Raw Material for Lacquers
    and Adhesives. Gelatine, Leim, Klebstoffe, vol. 10,
    1942, pp. 55-58, 79-83. C. A., vol. 37, no. 17, 1943,
    p. 5162.

20. Becher, C.: Manufacture of Adhesives: Gelatine, Leim,
    Klebstoffe, vol. 10, 1942, pp. 27-32, 49-55, 73-78, 99-
    102. C. A., vol. 37, no. 17, 1943, p. 5162.

21. Moore, H. T., and Vogler, H. J.: Plastics and Plywood.
        Compressed Air Mag., vol. 48, 1943, pp. 7164-7168.
        C. A., vol. 38, no. 4, 1944, p. 809.

22. Zhibitskii, Ya. I.: Plastic Masses and Their Use in Air-
        plane Construction. Khim. Referat. Zhur., vol. 4, 1941,
        pp. 7-8, 116. C. A., vol. 38, no. 4, 1944, p. 809.

23. Lehmann, E.: The Raw Materials of the Adhesive Industry.
        Seifensieder-Ztg., vol. 70, 1943, p. 9. C. A., vol. 38,
        no. 7, 1944, p. 1584.

24. Meijer, O., and Bon, W. F.: Symposium on Adhesives and
        Glues. Chem. Weekblad, vol. 39, 1942, pp. 102-107.
        C. A., vol. 38, no. 7, 1944, p. 1584.

25. Beacher, C.: The Manufacture of Adhesives. Gelatine,
        Leim, Klebstoffe, vol. 10, 1942, pp. 49-55. C. A.,
        vol. 38, no. 10, 1944, p. 2415.

26. Petz, A.: New Synthetic Substances as Raw Materials in
        the Adhesive Industry. Kunststoffe, vol. 32, 1942, pp.
        49-54. C. A., vol. 38, no. 10, 1944, p. 2415.

27. Leverone, L. F.: Adhesives Developed for Wartime Uses.
        The Converter, vol. 18, no. 6, 1944, pp. 8-9. C. A.,
        vol. 38, no. 19, 1944, p. 5326.

28. Adhesives. 1944 Plastics Catalog, p. 836.

    e. Casein:

1. Markovich, I. T.: Glutinosity III. Glutinosity and the
        Gluing Properties of Some Casein Glues. Colloid Jour.
        (U.R.S.S.), vol. 5, 1939, pp. 393-398. C. A., vol. 34,
        no. 16, 1940, p. 5565.

2. Ginzburg, L. Ya.: Casein Adhesive and Its Application to
        Cardboard Backstays. Kozhvenno-Obuvnaya Prom.(U.R.S.S.),
        vol. 19, no. 1, 1940, pp. 14-17. C. A., vol. 35, no. 5,
        1941, p. 1543.

3. Partisch, K. J.: Latex Adhesives. Seifensieder-Ztg., vol.
        67, 1940, pp. 289-299. C. A., vol. 36, no. 1, 1942,
        p. 188.

4. Halls, E. E.: Casein Adhesives and Cements. Plastics, vol.
        5, 1941, pp. 123-124. C. A., vol. 36, no. 22, 1942,
        p. 7186.

5. Horst, F. W.: Cold Casein Adhesive. Gelatine, Leim,
      Klebstoffe, vol. 9, 1941., pp. 75-78. C. A., vol. 38,
      no. 9, 1941, p. 2140.

      f. Cellulose Derivatives:

1. von Artus, F.: Leather Adhesives. Gelatine, Leim,
      Klebstoffe, vol. 8, 1940, pp. 51-54. C. A., vol. 35,
      no. 5, 1941, p. 5212.

2. Zayarnyi, V. I.: A New Water-Resistant Adhesive for Wooden
      Constructions. Khim. Referat. Zhur., no. 1, 1940, pp.
      134-135. C. A., vol. 36, no. 7, 1942, p. 2042.

3. Upright, R. M., Kin, M., and Peterson, F. C.: An Evalua-
      tion of Methocel as a Pigment Adhesive for Paper Coat-
      ings. Paper Trade Jour., vol. 114, no. 2, 1942, pp. 36-
      40. C. A., vol. 36, no. 7, 1942, p. 2137.

4. Micksch, K.: Methyl Cellulose Adhesive. Nitrocellulose,
      vol. 12, 1941, pp. 47-50. C. A., vol. 36, no. 16, 1942,
      p. 4931.

5. Micksch, K.: Cellulose Adhesives. Nitrocellulose, vol.
      13, 1942, pp. 64-69, 87-88. C. A., vol. 37, no. 17,
      1943, p. 5162.

6. Gourlay, P.: Composition, Preparation, and Use of Nitro-
      cellulose Adhesives. Chem. Zentr., no. II, 1942, p. 975.
      C. A., vol. 37, no. 18, 1943, p. 5514.

7. Schirmann, A.: Raw Material Basis of Substitute Adhesives.
      Farben-Ztg., vol. 48, 1943, pp. 40-41. C. A., vol. 38,
      no. 17, 1944, p. 4720.

      g. Furane Resins:

1. Delmonte, J. Furfural Resin Adhesives for Aircraft Use.
    . Pacific Plastics Mag., vol. 2, no. 4, 1944, pp. 14-15.
      C. A., vol. 38, no. 17, 1944, p. 4720.

      h. Gelatin and Glue:

1. Horwitz, S.: Adhesives. Natural Glues in the Veneer and
      Plywood Industry. Wood, vol. 4, 1939, pp. 462-465.
      C. A., vol. 34, no. 5, 1940, p. 1413.

2. Horst, F. W.:   Commercial Practice and Analytical Methods
      in the Production of Gelatin and Glue. Gelatin, Leim,
      Klebstoffe, vol. 7, 1939, pp. 147-157. C. A., vol. 34,
      no. 5, 1940, p. 1510.

3. Goette, H.:   Advances in Manufacture and Use of Glue.
      Knochenverarb. und Leim, vol. 1, 1939, pp. 137-139, 164-
      166. C. A., vol. 34, no. 6, 1940, p. 1874.

4. van der Werth, A.:   Technical Developments in the Manufac-
      ture of Glue and Gelatin. Knochenverarb. und Leim, vol.
      2, 1940, pp. 3-9. C. A., vol. 34, no. 13, 1940, p. 4606.

5. von Artus, F.:   Glue and Gelatine. Gelatine, Leim,
      Klebstoffe, vol. 7, 1939, pp. 176-179. C. A., vol. 35,
      no. 20, 1941, p. 7232.

6. Spaskii, N. A., and Vasileva, S. T.:   An Adhesive of the
      "Lepage" type for Zincography and Offset Print. Chem.
      Zentr., no. II, 1940, p. 1388. C. A., vol. 36, no. 16,
      1942, p. 5051.

7. Pakovich, I.:   Liquid Adhesive of the "Lepage" Type for
      Hot Enamel. Chem. Zentr., no. II, 1940, p. 1388. C. A.,
      vol. 36, no. 16, 1942, p. 5051.

    i. Inorganic Adhesives:

1. Schweig, B.:   Water Glass. Glass, vol. 18, 1941, pp. 8-10,
      40-42, 45, 72-74, 102-104, 115. C. A., vol. 35, no. 11,
      1941, p. 3776.

2. Molisch, F.:   Recent Research on Borate Adhesive. Chem.-
      Ztg., vol. 65, 1941, pp. 474-475. C. A., vol. 38, no.
      10, 1944, p. 2415.

    j. Phenolic Resins:

1. Kreitser, G. D., and Klimova, O. M.:   Phenol-Lignin for
      Gluing. Khim. Referat. Zhur., vol. 4, 1939, pp. 130-131.
      C. A., vol. 34, no. 6, 1940, p. 1773.

2. Perry, T. D.:   Resin Bonds for Plywood Box Shook. Wood
      Products, vol. 45, no. 12, 1940, pp. 35-37. C. A., vol.
      35, no. 3, 1941, p. 822.

3. Perry, T. D.:   Aircraft Plywood and Adhesives. Jour. Aero.
      Sci., vol. 8, 1941, pp. 204-216. C. A., vol. 35, no. 10,
      1941, p. 3359.

4. Klein, L.: Phenolic Resins for Plywood. Ind. Eng. Chem.,
      vol. 33, 1941, pp. 975-980. C. A., vol. 35, 1941, p.7059.

5. Trevy, P.: Phenol-Formaldehyde Resins in the Manufacture of
      Plywood. Rev. Gen. Mat. Plastiques, vol. 16, suppl. no.
      2, 1940, pp. 30-33. C. A., vol. 38, no. 10, 1944, p.2415.

6. Chulitskii, N. N.: "WIAM-B3" Adhesive for Wood Aircraft
      Construction. Chem. Zentr., vol. II, 1941, p. 149,
      C. A., vol. 38, no. 5, 1944, p. 1044.

   k. Natural and Synthetic Rubber:

1. Belik, V. F., and Peresteronina, L. F.: Adhesive Contain-
      ing Synthetic Rubber. Kozhvenno-Obuvnaya Prom. (U.R.S.S.),
      vol. 15, no. 7, 1939. C. A., vol. 34, no. 14, 1940,
      p. 4832.

2. Nisnevich, E. A.: Adhesive from Soviet Gutta-Percha. Khim.
      Referat. Zhur., no. 12, 1939, p. 111. C. A., vol. 35,
      no. 3, 1941, p. 823.

3. Slepyan.: Aqueous Dispersion of a Cement of Synthetic Rub-
      ber Instead of a Solution in Gasoline. Kozhevenno-
      Obuvnaya Prom. (U.R.S.S.), vol. 19, no. 2, 1940, p. 38.
      C. A., vol. 35, no. 5, 1941, p. 1543.

4. Maslovskii, V. A., and Gol'dina, B. G.: Soap-Rubber Pastes
      and Self-Vulcanizing Cements with a Base of Synthetic
      Rubber. Kozhvenno-Obuvnaya Prom. (U.R.S.S.), vol. 19,
      no. 5, 1940, pp. 20-21. C. A., vol. 35, no. 6, 1941,
      p. 2030.

5. Tugov, I. I.: Cementing Rubber Soles. Kozhvenno-
      Obuvnaya Prom. (U.R.S.S.), vol. 19, 1940, pp. 9-10, 31-
      32. C. A., vol. 35, no. 15, 1941, p. 5349.

6. Wheeler, R. L.: Uses and Testing of Rubber Adhesives.
      Rubber Age, vol. 49, 1941, pp. 169-171. C. A., vol. 35,
      no. 22, 1941, p. 8362.

7. Park, C. R.: Rubber Technology between the Wars. News Ed.
      (Am. Chem. Soc.), vol. 19, 1941, pp. 1393-1397. C. A.,
      vol. 36, no. 8, 1942, p. 2439.

8. Schirmann, A.: Rubber Adhesives. Papierwarn-Ztg., vol. 45,
      1941, pp. 134-136. C. A., vol. 36, no. 11, 1942, p. 3392.

9. Adinoff, S.:   Manufacture and Properties of Rubber Adhe-
        sives. India-Rubber Jour., vol. 102, 1941; pp. 127-128.
        C. A., vol. 36, no. 11, 1942, p. 3392.

10. Earle, R. D.:   Neoprene Cements and Solvent Compounds.
        India Rubber World, vol. 106, 1942, pp. 570-571.
        C. A., vol. 36, no. 22, 1942, p. 7360.

11. Campbell, A. W., and Burns, J. W.: Nitroparaffins in the
        Rubber Industry. India Rubber World, vol. 107, 1942,
        pp. 169-170. C. A., vol. 37, no. 7, 1943, p. 1891.

12. Philipp, C.:   Rubber Adhesives, Cements, and Packing
        Materials; Their Development in the Last Ten Years as
        Shown in the Patent Literature. Knochenverarb.und Leim,
        vol. 3, 1941, pp. 203-207, 219-223. C. A., vol. 37,
        no. 7, 1943, p. 1892.

13. Maslovskii, V. A., and Gol'dina, B. G.: A Self-Vulcanizing
        Adhesive from SKB (Rubber). Kozhvenno-Obuvnaya Prom.,
        vol. 19, 1940, pp. 43-44. C. A., vol. 37, no. 10, 1943,
        p. 2957.

14. Schirmann, A.:   Rubber Adhesives Based on Domestic (German)
        Raw Materials. Gummi-Ztg., vol. 56, 1942, pp. 185-186.
        C. A., vol. 37, no. 18, 1943, p. 5620.

15. Sarback, D. V.: Synthetic Rubber Cements I and II. India
        Rubber World, vol. 108, 1943, pp. 249-252, 261, 363-367.
        C. A., vol. 37, no. 21, 1943, p. 6493.

1. Starches and Dextrins:

1. Spasskii, N. A.: Preparation of Soluble Starch. Chem.
        Zentr., no. II, 1938, p. 2547. C. A., vol. 34, no. 16,
        1940, p. 5565.

2. Spasskii, N. A., and Vasil'eva, S.: Book-Binding Adhesive
        from Starch Oxidized with Chromic Acid. Chem. Zentr.,
        no. II, 1939, p. 307. C. A., vol. 35, no. 9, 1941,
        p. 3003.

3. Obst.: Colloidal Adhesives with Admixtures, Part of Which
        Are Mineralized to Improve Their Properties. Knochen-
        verarb.und Leim, vol. 2, 1940, pp. 28-31. C. A., vol.
        36, no. 13, 1942, p. 3873.

4. Heiser, T. G.: Dextrin for the Envelope Industry. The
      Converter (Paper and Board), vol. 15, no. 5, 1941, pp.
      2-3. C. A., vol. 37, no. 4, 1943, p. 1055.

5. Mullen, J. W., and Pascu, E.: Starch Studies. Possible
      Industrial Utilization of Starch Esters. Ind. Eng.
      Chem., vol. 35, 1943, pp. 381-384. C. A., vol. 37,
      no. 9, 1943, p. 2606.

6. Killinger, J. E.: Lamination of Weatherproof Solid Fiber-
      board with Starch and Resin Adhesives. Paper Trade
      Jour., vol. 117, no. 19, 1943, pp. 25-30. C. A., vol.
      38, no. 6, 1944, p. 1360.

   m. Urea and Melamine Resins:

1. Perry, T. D.: Resin Bonds for Plywood Box Shook. Wood
      Products, vol. 45, no. 12, 1940, pp. 35-37. C. A.,
      vol. 35, no. 3, 1941, p. 822.

2. Hodgins, T. S., and Hovey, A. G.: Urea-Formaldehyde Film-
      Forming Compositions. Air-Drying Films by Acid Catalysts.
      Ind. Eng. Chem., vol. 33, 1941, pp. 512-515. C. A., vol.
      35, no. 10, 1941, p. 3358.

3. Perry, T. D.: Aircraft Plywood and Adhesives. Jour. Aero.
      Sci., vol. 8, 1941, pp. 204-216. C. A., vol. 35, no.
      10, 1941, p. 3359.

4. Trussell, E. H.: Melamine, Urea, and Alkyd Resins.
      Official Digest. Federation Paint Oil and Varnish Clubs,
      vol. 206, 1941, pp. 257-266. C. A., vol. 35, no. 15,
      1941, p. 5212.

5. Hodgins, S., et al.: Melamine-Formaldehyde Film-Forming
      Compositions. Ind. Eng. Chem., vol. 33, 1941, pp. 769-
      779. C. A., vol. 35, no. 21, 1941, p. 7577.

6. Maskew, R.: Applications of Urea-Formaldehyde Resin Glues.
      Aircraft Eng., vol. 13, 1941, pp. 171-172. C. A., vol.
      35, no. 22, 1941, p. 8147.

7. Ohl, F.: Glue and Adhesives for Commercial Containers.
      Knochenverarb. und Leim, vol. 2, 1940, pp. 26-28.
      C. A., vol. 36, no. 17, 1942, p. 5285.

8. Sperski, S. F.: Improvements in Urea-Formaldehyde Adhe-
      sives. Wood Products, vol. 48, no. 4, 1943, pp. 14-15,
      57. C. A., vol. 37, no. 13, 1943, p. 3853.

9. Hodgins, T. S.: Urea-Resin Bonded Plywood. Pacific
      Plastics Mag., vol. 2, no. 5, 1944, pp. 24-26. C. A.,
      vol. 38, no. 19, 1944, p. 5326.

n. Vegetable Proteins, Gums, Waste Products:

1. Brother, G. H., McKinney, L. L., and Suttle, W. C.:
      Protein Plastics from Soybean Products. Laminated
      Material. Ind. Eng. Chem., vol. 32, 1940, pp. 1648-
      1651. C. A., vol. 35, no. 5, 1941, p. 1541.

2. Vedrinskii, A. I.: Adhesive from the Algae of the White
      Sea. Chem. Zentr., no. II, 1939, p. 307. C. A.,
      vol. 35, no. 9, 1941, p. 3003.

3. Stewart, C. W.: A New Adhesive for Paper Clay Coatings.
      Pulp Paper Mag. Can., vol. 43, 1942, p. 333. C. A.,
      vol. 36, no. 9, 1942, p. 2719.

4. Chechel, N. S.: Acid Resistant Materials Used in the
      Werchnedneprowsksch Plant for the Chemical Processing
      of Vegetable Wastes. Chem. Zentr., no. I, 1941, p. 992.
      C. A., vol. 37, no. 2, 1943, p. 480.

5. Vorob'ev, V. A.: Plastic Masses for Bituminous Roofing
      Material. Khim. Referat. Zhur., no. 10-11, 1940, p. 85.
      C. A., vol. 37, no. 4, 1943, p. 1025.

6. Narayanamurti, D., et al.: Studies on Adhesives. Dehra
      Dun, U. P.: Forest Research Inst. C. A., vol. 37,
      no. 6, 1943, p. 1530.

7. Rangel, J. L.: Angico Gum. Rev. Quim. Ind. (Rio de Janeiro),
      vol. 12, 1943, pp. 16-18, 128-130. C. A., vol. 37, no. 20,
      1943, p. 6055.

8. von Artus, F.: Sulfite Waste Liquors in the Adhesives
      Industry. Gelatine, Leim, Klebstoffe, vol. 10, 1942,
      pp. 97-99. C. A., vol. 37, no. 21, 1943, pp. 6370.

9. Slotboom, H. W.: Asphalt Bitumen as an Adhesive. Chem.
      Weekblad, vol. 39, 1942, pp. 93-97. C. A., vol. 38, no.10,
      1944, p. 2410.

10. Beacher, C.: Adhesives from Sulfite Waste Liquor.
      Seifensieder-Ztg., vol. 69, 1942, pp. 324-325. C. A.,
      vol. 38, no. 12, 1944, p. 3045.

11. Beacher, C.: Adhesive Materials from Sulfite Waste Liquors.
       Seifensieder-Ztg., vol. 69, 1942, pp. 355-356.
       C. A., vol. 38, no. 14, 1944, p. 3748.

    o. Vinyl Resins:

1. Light, L.: Polymerization of Maleic Esters. Paint Manuf.,
       vol. 10, 1940, p. 243. C. A., vol. 35, no. 3, 1941,
       p. 822.

2. Paselli, P.: Polyvinyl Chloride Pastes. Materie Plastica,
       vol. 7, 1940, pp. 97-107. C. A., vol. 35, no. 21, 1941,
       p. 7577.

3. Lombardo, G.: Some Hints Regarding Vinyl Emulsions.
       Nitrocellulose, vol. 13, 1942, p. 112. C. A., vol. 37,
       no. 19, 1943, p. 5802.

                         2. Patents

    a. Phenolic Resins.

1. Cresol - Formaldehyde
       United States: 2,232,718; 2,271,744.

2. Phenol - Formaldehyde
       United States: 2,186,369: 2,218,373; 2,229,357;
          2,267,390; 2,287,536; 2,304,263; 2,309,610;
          2,314,076; 2,317,364; 2,319,142.

       British: 532,716; 540,404; 544,845.

       French: 842,208; 845,339.

       German: 699,605; 719,694; 725,499; 725,650.

3. Resorcinol - Formaldehyde
       United States: 2,314,996.

    b. Organic Nitrogen Resins:

1. Alkylolcyanamide
       United States: 2,300,570.

2. Alkylolguanidine
       United States: 2,298,473.

3. Bisthioammeline polyalkylene ether
   United States: 2,325,105.

   British: 546,373.

4. Ethylene Imine
   German: 729,248.

5. Melamine - Aldehyde
   United States: 2,318,121; 2,331,446.

   British: 549,496.

   German: 721,240.

6. Superpolyamides
   United States: 2,224,037; 2,281,415; 2,296,555.

   German: 721,187.

7. Urea - Formaldehyde
   United States: 2,180,547; 2,190,239; 2,192,585;
      2,193,630; 2,203,501; 2,223,536; 2,247,764;
      2,275,821; 2,283,740; 2,287,756; 2,290,946;
      2,303,982; 2,304,600; 2,306,057; 2,312,210;
      2,314,308; 2,315,776; 2,320,301.

   British: 512,659; 516,915; 521,653; 531,356; 536,493;
      545,409.

   French: 851,404.

   German: 681,324; 681,372; 698,656; 722,218; 736,618.

   c. Alkyd Resins:

   United States: 2,194,013; 2,202,765; 2,215,219;
      2,224,035; 2,230,230; 2,252,393; 2,280,256; 2,288,315.

   British: 544,057; 547,328.

   d. Furane Resins:

1. Furfuryl Alcohol - Formaldehyde
   United States: 2,306,924.

2. Furfuryl Silicate
   United States: 2,300,812

e. Polymerization Resins:

1. Acrylic Polymers

    a. Acrylic Acid Esters
       United States: 2,214,158; 2,221,367; 2,280,981.

       German: 575,327; 705,520.

    b. Methacrylic Acid Esters
       United States: 2,199,597; 2,231,471; 2,268,611;
          2,280,981, 2,281,589.

       German: 697,083; 705,329.

2. Ethylene Polymers
       United States: 2,219,684; 2,263,249.

       British: 544,359.

3. Styrene Polymers
       United States: 2,276,478.

       British: 522,553.

       German: 698,656.

4. Vinyl Acetal Polymers
       United States: 2,197,420; 2,200,969; 2,205,020;
          2,213,751; 2,222,490; 2,227,983; 2,232,806;
          2,233,941; 2,240,027; 2,274,672; 2,279,145;
          2,279,901; 2,317,891; 2,327,652.

       British: 525,556.

       Canadian: 397,250; 397,476.

       German: 690,332.

5. Vinyl Alcohol Polymers
       United States: 2,234,829; 2,242,019.

       German: 704,462.

6. Vinyl Ester Polymers
       United States: 2,168,220; 2,209,435; 2,219,433;
          2,259,490; 2,319,826; 2,322,048.

Australian: 108,199.

British: 510,826; 511,996; 512,478; 542,658; 542,964.

German: 687,486; 705,520; 731,932.

7. Vinyl Ether Polymers
   United States: 2,300,587.

   French: 849,442.

   German: 705,394.

8. Vinyl Halide Polymers
   United States: 2,261,313; 2,300,587.

   French: 845,569.

   German: 698,655; 713,793.

9. Vinyl Lactam Polymers
   United States: 2,265,450.

   f. Cellulose Derivatives:

1. Cellulose Esters
   United States: 2,176,837; 2,188,395; 2,214,286;
      2,223,575; 2,234,236; 2,258,991; 2,263,661;
      2,281,483; 2,296,891; 2,324,097; 2,324,680;
      2,325,700.

   British: 514,172.

   Canadian: 395,145; 400,105.

   German: 681,322; 707,659; 730,306.

   Russian: 52,331.

2. Cellulose Ethers
   United States: 2,171,140; 2,210,704; 2,224,523;
      2,273,677; 2,285,178; 2,319,834; 2,329,741;
      2,330,313.

   British: 529,993.

   Canadian: 398,320; 400,643.

French: 841,836; 841,885.

German: 716,221; 735,864.

g. Carbohydrates (Except Cellulose Derivatives)

1. Dextrins
   United States: 2,172,357; 2,174,541; 2,181,782;
      2,188,099; 2,190,372; 2,204,384; 2,210,119;
      2,241,700; 2,287,599; 2,303,791; 2,304,730.

2. Gums
   United States: 2,220,988; 2,319,102.

3. Starches
   United States: 2,194,216; 2,202,678; 2,212,557;
      2,215,847; 2,215,849; 2,221,484; 2,222,872;
      2,222,873; 2,222,874; 2,222,875; 2,238,767;
      2,258,741; 2,275,314; 2,282,364; 2,283,044;
      2,321,072.

   British: 511,026; 527,704; 543,432; 543,433.

   Canadian: 403,788.

   French: 852,825; 852,826; 852,827.

   German: 719,568.

h. Proteins:

1. Animal Glue
   United States: 2,170,273; 2,176,038; 2,182,425;
      2,214,231; 2,226,553; 2,235,202; 2,246,405;
      2,265,144; 2,282,177; 2,308,185; 2,320,087;
      2,323,831.

   British: 505,868.

   Canadian: 394,976; 413,995.

   German: 700,759.

2. Blood Albumin
   United States: 2,180,542; 2,307,198.

3. Casein
   United States: 2,180,542; 2,180,543; 2,182,357;
      2,197,168; 2,300,907; 2,302,378; 2,330,428;
      2,332,519; 2,334,270.

Australian: 110,458.

British: 531,084; 540,326; 543,302; 543,325.

4. Chitin
   United States: 2,201,762.

   German: 716,428.

5. Seed Meal
   United States: 2,174,438; 2,233,213; 2,243,871;
      2,297,340; 2,312,056; 2,332,801.

6. Soybean
   United States: 2,178,566; 2,260,640; 2,271,620;
      2,274,983; 2,284,700.

   Japanese: 134,071, 134,130.

7. Zein
   United States: 2,229,028; 2,250,040.

   Canadian: 406,768.

   German: 716,340.

   i. Rubbers:

1. Butadiene Polymers
   United States: 2,265,722; 2,273,880.

   Russian: 53,402.

2. Chloroprene
   United States: 2,212,611; 2,286,505; 2,300,352;
      2,328,351.

3. Cyclized Rubber
   United States: 2,300,368.

4. Halogenated Rubber
   United States: 2,234,621; 2,259,190.

   British: 524,070.

5. Isobutylene Polymers
   United States: 2,213,331; 2,226,589; 2,319,959.

   French: 849,983.

6. Natural Rubber
    United States: 2,203,677; 2,209,451; 2,226,938;
        2,232,791; 2,240,862; 2,254,321; 2,256,194;
        2,257,083; 2,259,350; 2,263,305; 2,269,660;
        2,277,992; 2,278,355; 2,278,609; 2,279,110;
        2,281,087; 2,284,947; 2,297,837; 2,295,866;
        2,297,871; 2,300,592; 2,304,678; 2,310,972;
        2,311,301; 2,318,126; 2,335,104..

    British: 514,037; 517,816; 521,108; 521,401; 522,057;
        523,152; 531,203; 533,630; 542,331; 547,841; 551,398.

    Canadian: 391,000; 393,229; 393,230; 400,442; 407,463;
        409,65L; 415,026; 415,030.

    Dutch: 49,687.

    French: 844,367.

    Russian: 54,276; 57,435.

    Swiss: 213,019.

7. Phenol - Formaldehyde Modified Rubber
    United States: 2,314,997; 2,343,551.

    British: 530,697; 544,944.

    Canadian: 415,029.

8. Neoprene
    United States: 2,196,602; 2,226,541; 2,313,039,

9. Rubber Hydrochloride
    United States: 2,174,673; 2,218,617; 2,320,716.

10. Sulfide Polymers
    United States: 2,206,643; 2,252,366.

    German: 707,438; 709,691.

    j. Miscellaneous Natural Organic Products:

1. Asphalt
    United States: 2,175,767; 2,280,653; 2,283,937;
        2,286,244; 2,290,833; 2,322,886.

    British: 533,927.

    Canadian: 405,350.

2. Bitumins
    United States: 2,280,699.

    British: 519,119;   519,463;   538,105.

    French: 847,749;   847,829;   850,940.

3. Fatty Acid Salts
    United States: 2,284,570.

    Canadian: 415,383.

    German: 694,158.

    Japanese: 128,323;   129,852.

4. Lecithin
    British: 525,250.

5. Pitches
    Unites States: 2,208,580;   2,218,335;   2,288,293.

    British: 533,546.

    German: 736,874.

    Russian: 544,518;   55,150.

6. Rosin Esters
    United States: 2,179,339;   2,223,086;   2,285,416;
        2,307,801;   2,319,271.

    German: 710,324.

    Russian: 55,670.

7. Wood Waste Derivatives
    United States: 2,294,666;   2,319,883:

8. Waxes
    German: 702,740;   704,088;   704,754.

    Russian: 52,976.

    Swiss: 209,644.

k. Inorganic Substances:

1. Boron Compounds
   United States: 2,219,583; 2,223,349; 2,231,718.

   Canadian: 390,041.

2. Phosphorus Compounds
   British: 521,694.

3. Silicon Compounds
   United States: 2,215,048; 2,239,358; 2,261,784;
     2,278,345; 2,285,053; 2,287,410.

   Belgian: 440,870.

   British: 526,462; 529,593; 542,655; 552,143.

   German: 688,575; 698,389; 701,503.

3. Aircraft Manufacturers' Reports

a. Allied Aviation Corp., Cockeysville, Md.

1. Tests on Thermosetting Adhesives for Rubber Bag Cooking.

2. Test Program for Durez Resin 11814.

3. Shear Block Tests - Cascophen Resins.

4. Tests of Cast Durez Resin.

5. Tests for Special Assembly Using Cold Setting Durez 11814.

6. Shear Block Tests Using Cold Setting DuPont Adhesive
   J4600 X 5100.

7. Test on Melmac 401.

8. Shear Block Tests on 8 Miscellaneous Adhesives.

9. Shear Block Tests on Durez 11814 with Catalyst 7422.

10. Comparison of Various Percentages of No. 7422 Accelerator-
    Durez 12041.

11. Shear Block Tests Using Durez Resin 12041.

12. Reports and Graphs on Miscellaneous and Sundry Tests.

b. Beech Aircraft Corp., Wichita 1, Kansas:

1. Resin Glue Specification for Wood Gluing.

2. Cementing Similar and Dissimilar Materials - Sealers, Non-Skid Walkway and Floor Material.

c. Boeing Airplane Co., Wichita, Kansas:

1. A Comparison of Commercial Rubber Cements for Bonding Insulation to Wood or Metal. Rep. No. 841.

2. Tests on Cascamite Cold-Setting Resin Glue, Rep. No. 6341.

3. Gluing to a Glue-Coated Surface - Casein Glue. Rep. No. 6354.

4. Hot Press Gluing of Laminated Spars, Scarf Joints and Ribs. Plaskon 250-2. Rep. No. 6372.

5. Tests on One-Tenth Inch Laminated Fir Spar Stock. Rep. No. 6375.

6. Fatigue Tests on Wood and Glued Wood Assemblies. Rep. No. WD-10464.

7. Specification for Hot Press Gluing Spars. Rep. No. WD-11051.

8. Gluing of Paper Base Phenolic Plastic. Rep. No. WD-11101.

9. Specification for Gluing Paper Base Phenolic Plastic. Rep. No. WD-11102.

10. Cement for Bonding Insulation Material to Metal. Rep. No. WD-11104.

11. Amberlite PR-75B; Low Temperature Phenol-Formaldehyde Glue. Rep. No. WD-11105.

12. Technical Information on Adhesives. Rep. No. D-3790.

13. Boeing Process Specification for General Application of Cements and Glues. Rep. No. BAC 5010.

14. Boeing Process Specification for Joining and Insulating Air Ducts. Rep. No. BAC 5403.

15. Boeing Process Specification for the Handling and Cementing of Methyl Methacrylate Enclosures with Synthetic Rubber Mountings. Rep. No. BAC 5410.

16. Design Manual, Sec. 12.11.   Rep. No. D-5000.

17. Miscellaneous Tests on Synthetic Resin Adhesives.   Rep.
        No. T-24549.

    d. Bell Aircraft Corp., 2050 Elmwood Ave., Buffalo 7, N.Y.:

1. Cycle-Welding 24S-T Alclad to Birch.   Rep. No. BTR 43-86.

    e. Chance Vought Aircraft, Stratford, Conn.
        (Division of United Aircraft Corp.)

1. Rubber Cements - Commercial and Synthetic Bonding Neoprene
        Sheeting to Aluminum Alloys.   Rep. No. 38.

2. Cements - Rubber or Neoprene to Metal (Gasoline and Oil
        Resistant).   Specification No. 99.

3. Wood Gluing; Cold Setting Urea.   Specification No. 110.

4. General Purpose Cement.   Specification No. 111.

5. Application of Fabric to Metal or Plywood Surfaces.
        Specification No. 113.

6. Attachment of Walkways.   Specification No. 114.

    f. Consolidated Vultee Aircraft Corp., San Diego 12, Calif.:

1. Development and Use of Metlbond.   Rep. No. ZM-223.

    g. Curtiss-Wright Corp., Louisville, Ky.

1. Material Substitution at Curtiss-Wright.   Rep. No. GI-104-D2.

2. Preparation and Application of "Weldwood" Plastic Glue.
        Rep. No. L3-12-1

3. Cementing Procedure - Antenna Reflectors.   Rep. No. L-3-12-2.

4. Accelerated Gluing of Scarf Inlays.   Rep. No. L-3-12-3.

5. Cementing Flap Seals (CE 10003) to Flap Closures.   Rep. No.
        L-3-12-4.

6. Cementing of Gap Closures on C-76 Airplanes.   Rep. No.
        L-3-12-5.

7. Shop Procedure for the Use of Infra Red Heat Lamps in Curing
        Glue Bonds.   Rep. No. L-3-12-6.

8. Haskelite Moulded Part Using Dry-Film Glue. Rep. No.
    L-43-6.

9. Accelerated Curing of Plaskon 250-2 Glue. Rep. No. L-43-14.

10. Glue Bonds Floor and Side of Ship No. 7. Rep. No. L-43-25.

11. Comparison of Elastic Cements. Rep. No. L-43-35.

12. U.S. Rubber Co., No. 355 Cement. Rep. No. L-43-36.

13. Cold Setting National Liquid Resin Glue. Rep. No. L-43-61.

14. Bakelite Urea Resin with Catalyst. Rep. No. L-43-64.

15. Investigation of Lauxite 77-X. Rep. No. L-43-69.

16. Plaskon Resin Glue 201 and 250-2. Rep. No. L-43-70.

17. Cascamite Urea Resin Glues. Rep. No. L-43-71.

18. M and MT Miracle Adhesives. Rep. No. L-43-77.

19. Fairpreen Caulking Compound and Cement. Rep. No. L-43-81.

20. Uformite Resin Adhesives CS-551 and 552. Rep. No. L-43-82.

21. Le Pages Panite Plastic Resin Glue. Rep. No. L-43-84.

22. Perkins Resin Glue. Rep. No. L-43-87.

23. Glue Film Thickness on pH. Rep. No. L-43-88.

24. Uformite Resin Glue No. 500. Rep. No. L-43-90.

25. Uformite Resin Glue No. 430. Rep. No. L-43-92.

26. Hot Press Cascamite 66 with Catlyst H-19. Rep. No. L-43-96.

27. Hot Press Uformite 500 with Catlyst Y. Rep. No. L-43-97.

28. Effect of Drying Time on pH of Glue Film. Rep. No. L-43-100.

29. Riveted Panel Reinforced with Thermoset Adhesive. Rep. No.
    NE-93-S1.

30. Plastics in the P-40 Box. Rep. No. PC-227-D1.

31. C-46 Floor Door. Rep. No. PE-127-D1.

32. C-46 Pedestal Control Knobs.   Rep. No. PE-217-D1.

33. An Approximate Elastic Solution for the Jointing of Two
      Similar Plates by Adhesion.   Rep. No. RP3-S1.

34. Tests of C-76 Yellow Poplar Plywood.   Rep. No. SH-106-S1.

35. Tests of C-76 Yellow Poplar Plywood.   Rep. No. SH-106-S2.

36. The Small Bending Theory for Flat Laminated Plates.   Rep.
      No. 5S-13.

37. Static Test of a Plywood Floor Panel.   Rep. No. 5S-14.

38. Results Obtained in the Gluing of Compreg.   Rep. No. 5S-15.

39. Acidity of Cold-Setting Urea Resin Adhesives.   Rep. No.
      5S-16.

40. Solubility of Resin Adhesives.   Rep. No. 5S-17.

41. "Free" Water in Urea Resin Adhesives.   Rep. No. 5S-18.

42. Gluing Resin Sealer Coated Wood.   Rep. No. 5S-19.

43. Progress Report on the Bonding of Aluminum Alloy.   Rep.
      No. 5S-20.

44. Alkaline Contamination of Resin Glues.   Rep. No. 5S-21.

45. Control of Wood Aircraft Manufacture and Inspection.
      Rep. No. 5S-23.

46. Properties of Artificial Resin Adhesives.   Rep. No. 5S-26.

47. Effect of Catalyst Proportion upon the Acidity.   Rep. No.
      5S-28.

48. The Veneer Orientation for Plywood Plates.   Rep. No. 5S-57.

49. A Preliminary Investigation of Lignin and Its Derivative
      Products.   Rep. No. WA-132-S1.

50. The Effect of the Bag Molding Process upon the Strength of
      Low Density Plywood.   Rep. No. WB-171-M1.

51. Cold Setting Phenolic Adhesives.   Rep. No. WE-11-M9.

52. Fatigue of Resin Bonded Wood Joints.   Rep. WE-11-M10.

53. Test of Resinox No. 840 (A Melamine Resin Film Adhesive)
    Rep. No. WE-11-S-1.

54. Test of Resinox No. 841 (A Melamine Resin Film Adhesive)
    Rep. No. WE-11-S-2.

55. Test of Penacolite, A Cold Setting Resorcinol Adhesive.
    Rep. No. WE-11-S4.

56. Properties of Urea Resin Adhesives. Rep. No. WE-11-S-5.

57. Properties of Artificial Resin Adhesives. Rep. No.
    WE-11-S-6.

58. Test of Du Pont Adhesive No. 4624. Rep. No. WE-11-S-7.

59. Test of Bakelite XCu - 16257 (Hardener XK 16229). A Craze
    Resistant Urea Resin Adhesive. Rep. No. WE-11-S-8.

60. Setting Rates of Urea Resin Glues. Rep. No. WE-15-S1.

61. Low Temperature Phenol Formaldehyde Adhesives. Rep. No.
    WE-16-S1.

62. Evaluation of Moderate and Low Temperature Adhesives, Du
    Pont 4631-J-85-0025 and Bostik T-46-M (A-300). Rep.
    No. WE-18-M6.

63. Test of Resinox No. 410, Wood to Metal Adhesive. Rep. No.
    WE-18-S1.

64. Test of Resimul No. 697, Wood to Metal Adhesive. Rep. No.
    WE-18-S2.

65. Bonding of Metal to Wood or Plastics with Bostik Adhesives.
    Rep. No. WE-18-S3.

66. C-76 Stringer Splice Fitting Bonded with Wood to Metal
    Adhesive. Rep. No. WE-18-S4.

67. Tests of du Pont J-4600-X-5579 Wood to Metal Adhesive.
    Rep. No. WE-18-S5.

68. Effect of Glue Layer Thickness on Strength of Bonded Wood
    Joint. Rep. No. WE-170-M2.

69. Effect of Low Temperatures upon the Strength of Plywood
    and Laminates. Rep. No. WE-189-M1.

70. The Effect of Sanding Birch and Maple Surfaces upon the
      Strength of the Glue Joint. Rep. No. WE-185-Sl.

    h. Kellett Aircraft Corp., Upper Darby, Pa.:

1. Tests of U.S. Rubber Adhesives and Filler Material. Rep.
      No. 1680.2.

    i. Lockheed Aircraft Corp., Burbank, Cal.:

1. Tentative Standard Methods of Testing Adhesives.
      Designation ADS-1.

    j. Republic Aviation Corp., Farmingdale, Long Island, N.Y.:

1. Cements for Aircraft Materials. Rep. No. ERT 452.

                4. Adhesives Manufacturers' Literature

    a. American Cyanamid Co., 30 Rockefeller Plaza, New York,N.Y.:

1. The Use of Urac 100 with Catalyst 57 Cold Setting Urea-
      Formaldehyde Synthetic Resin Glue.

2. Urac 101 Cold Setting Urea-Formaldehyde Synthetic Resin Glue.

3. Melurac 300.

4. Melmac Adhesive 400.

5. The Beetle Cements A and AF.

6. Laminac Resin P-4122.

    b. Bakelite Corporation, 30 East 42d St., New York 17, N.Y.:

1. Powdered Phenol Resin Glue BC-16168.

2. Powdered Phenol Resin Glue BC-16529.

3. Bakelite Cold Press Wood Bonding.

4. Warm-Setting Phenolic Resin Glue BC-17540.

5. Cold-Setting Phenolic Resin Glue XC-17613.

c. B.B. Chemical Co., 784 Memorial Drive, Cambridge 39, Mass.:

1. Physical Tests on Aluminum to Aluminum Bonds.

d. Carbide and Carbon Chemicals Corporation, 30 East 42d St., New York 17, N.Y.:

1. Vinylite Polyvinyl Acetate Resins.

2. "Vinylseal" Adhesives T 24-9 and MA 28-18.

e. Casein Company of America, 350 Madison Avenue, New York 17, N.Y.:

1. Wood and Glue at War.

2. The Story of Cascamite, America's New Plastic Glue.

3. Glued Prefabricated Houses.

4. Casco Gluing Guide.

5. The Casco Trouble Shooter for Joint Gluing.

6. The Use of Glue in Building Construction and Remodeling.

7. Glue Recommendations for U.S. Government Specifications.

8. Comparison Chart for Casco Glues.

9. Wood Glues for Aircraft Manufacture.

10. Time and Temperature Factors (for Use of Casein, Urea-Resin or Phenol-Resin Glue)

11. Bulletin No. SR-1. Cascola Water Resistant Case Sealing Glues for Sealing Flaps of V Boxes.

12. Bulletin No. 3. The Gluing of Compregnated Wood.

13. Bulletin No. 4. Coloring Urea-Resin Glue Solutions.

14. Bulletin No. CN-5a. A Shipping Room Glue of Wide Utility (Cascotin CN-5)

15. Bulletin No. 6. Glue Recommendations for "Fluid Pressure" or Bag-Gluing Techniques.

16. Bulletin No. 7. The Gluing of Wood with High Frequency
     Electrostatic Heating Equipment.

17. Bulletin No. 8. Resin Glues and Workers' Health.

18. Bulletin No. 9. Craze-Proofing of Urea Resin Glues.

19. Bulletin No. 10. Spraying Synthetic Resin and Casein Glues.

20. Bulletin No. 11. A Cold-Setting Cement for Bonding Metal
     to Wood and Other Dissimilar Materials (Casco Flexible
     Cement NT-442)

21. Bulletin No. 12. A Durable Flexible Cement of Wide Appli-
     cation (Casco Flexible Cement NT-475)

22. Bulletin No. 13. Edge Gluing with Urea Resin Glue in the
     Rotary Clamp.

23. Bulletin No. 14. Cleaning Glue Equipment.

24. Bulletin No. 15. Thinning Intermediate - Temperature -
     Setting Phenol Resin Glues.

25. Bulletin No. 16. Edge Gluing, Joint Gluing, Laminating
     with Casein Glue.

26. Bulletin No. 17. Cascamite 66-Cold Press with Flour
     Extender.

27. Bulletin No. 18. Casco-Resin 5 (Liquid)-Cold Press with
     Flour Extender.

28. Bulletin No. 19. The "Master Mix" Method of Using Urea
     Resin Glues.

29. Bulletin No. 20. A New, Room-Temperature-Setting Resin
     Glue Producing Durable, Boilproof Wood Joints.

30. Directions for Using Casco Resin for Hot-Press Gluing.

31. Casco Resin (Liquid) (Use with Catalyst H-19)

32. Cascamite TS - Cascamite TS-75.

33. Cascamite BG-2 (Use with Catalyst H-21)

34. Cascamite LA-27.

35. Cascamite 66 (Use with Catalyst H-19).

36. Cold Setting Urea-Resin Glue.

37. Cascophen LT-67 (Liquid Phenol-Formaldehyde Resin Glue).

38. Cascophen W-110.

39. Cascophen P-48.

40. Cascophen BG-17 (Use with Catalyst H-23).

41. Compregnite.

42. Cascophen BG-P15 (Containing Catalyst).

   f. Cordo Chemical Corporation, 34 Smith St., Norwalk, Conn.:

1. Cordo-Bond Adhesives. Catalog No. 1, July 1944.

   g. Chrysler Corporation, Detroit 31, Mich.:

1. Efficiency of Lap Joints.

2. Moisture and Humidity Resistance of the Cycle-Bond Process.

3. Cycle-Bond (Preliminary Report).

4. CB-2 Plywood Shear Immersion Tests.

5. Cycle-Weld CB-4 Process VS C-3 Cement.

6. High and Low Temperature Shear Tests on Cycle-Welded Alclad
      and Dow Metal Sheet.

7. Adhesion of 55-6 Cement to Various Materials.

8. Chrysler Direction Sheets and Process Standards.

9. Cycle Weld Chart.

10. Cycle Weld, Bonding of Wood to Metal.

   h. E. I. Du Pont de Nemours and Company, Parlin, N. J.:

1. Plastacele Handbook - Cellulose Acetate Plastic Sheets.

2. Lucite Manual - Methyl Methacrylate Resin.

3. 4624 Thermosetting Adhesive.

4. 4644 Thermoplastic Adhesive.

5. 5458 Adhesive.

6. 4646 Modified Thermoplastic Adhesive (Restricted).

7. 4653 Low Temperature Bonding Adhesive (Restricted).

    i. Durez Plastics and Chemicals, Inc., North Tonawanda, N.Y.:
        (Technical Bulletins)

1. Instructions for 192 Durez Resin for Bonding Douglas Fir.

2. Durez 194 Hot Press Resin Adhesive

3. Durez 194 Resin Adhesive for Bag Molding.

4. Durez Low Temperature Resin Adhesive (12041 with Catalyst
    7422)

5. Durez Low Temperature Alkaline Resin Adhesive (Tentative
    Instructions for the Use of 12533 with 12534B)

6. Durez 12688 - 12689 Room Temperature Resin Adhesive
    (Tentative Instructions)

    j. Durite Plastics, Frankford Station P.O., Philadelphia
        24, Pa.:

1. Special Data No. 1060, Durite S-2986, Heat-Setting Laminat-
    ing Bond, April 22, 1944.

2. Special Data No. 1061, Durite S-2983, Water Soluble Heat-
    Setting Resin, April 22, 1944.

3. Special Data No. 1064, Durite S-1643, Fabric Impregnant
    for Molded Shapes, May 1, 1944.

4. Special Data No. 1070 (Superseding Data No. 1042), Durite
    S-3026 Adhesive for Wood, etc., Setting to Room Temper-
    ature (Superseding Durite S-2682), July 14, 1944.

5. Special Data No. 1071, Heat Setting Adhesive for Plywood,
    June 7, 1944.

6. Special Data No. 1072, Durite S-2987, Boil-Proof and Light-
      Stable Thermosetting Resin for Treating and Laminating
      Fabric, Paper, etc., June 8, 1944.

7. Special Data No. 1073, Durite S-2988, Boil-Proof Thermo-
      setting Resin for Treating and Laminating Fabric, Paper,
      etc., June 8, 1944.

8. Special Data No. 1076 (Superseding Data Nos. 1068 and 1055),
      Durite S-3024, Heat-Setting Cement for Bonding Metals,
      Vitreous Substances, Thermoplastics, Polyvinyl Chloride,
      Butadiene Acrylonitrile Rubbers, etc., June 29, 1944.

9. Data No. 4 Adhesives of S-2979 Series, June 23, 1944.

   k. Monsanto Chemical Co., Plastics Division, Springfield
      2, Mass.:

1. Cementing Technics.

   l. Miracle Adhesives Corp., 261 Fabyan Place, Newark 8, N.J.:

1. General Directions for Miracle Adhesives - Types H - M - MT.
      (Specification M-200)

2. Directions for Installing Safety Treads (Specification M-202)

3. Recommended Spraying Equipment for Miracle Adhesive,
      Type P. Directions for Spraying Miracle Adhesive, Type P.
      (Specification M-203)

4. Directions for Applying Miracle Adhesive, Type P, with a
      Brush (Specification 203-A)

5. Directions for Installing Asbestos Fabric, Asbestos Listing,
      etc. (Specification M-204)

6. Directions for Installing Canvas (Specification M-205)

7. Directions for Installing Cork and Heavy Density Fibreglass
      Insulation (Specification M-206)

8. Directions for Installing Light Density Fibreglass and Batt
      Type Insulation (Specification M-207)

9. Directions for Installing Linotile (Specification M-208)

10. Directions for Installing Linoleum (Specification M-209)

11. Directions for Installing Wall Fixtures (Specification
    M-210)

12. A Leveling Plastic for Use under R-Mir-Dek, Tile, Linoleum,
    Linotile, etc. (Specification M-212)

13. Directions for Installing Cork, Insulation Board, Asbestos
    Board and Hard Board (Specification M-220)

14. Directions for Installing Glass Blocks (Specification M-221)

15. Directions for Installing Acoustical Board, Insulation
    Board, etc., to Ceilings (Specification M-222)

16. Directions for Installing Rubber with Miracle Adhesive,
    Type R (Specification M-250)

17. Directions for Installing Light Fabrics, Asbestos, Paper,
    etc., with Miracle Adhesive, Type R (Specification M-251)

    m. Pennsylvania Coal Products Company, Petrolia, Pa.:

1. Instruction Sheet, Penacolite G-1124.

2. Instruction Sheet, Penacolite G-1131.

    n. Perkins Glue Company, Lansdale, Pa.:

1. Perkins Resin Glues, Handbook, Fourth Edition.

2. Directions for Using Perkins Aircraft Casein Veneer Glue.

3. Perkins Urea-Formaldehyde and Melamine-Urea Resin Glues.
   General Instructions.

    a. Cold Pressing Technique
    b. Hot Plate Pressing Technique

4. Perkins L-100 with Boil-Proofing Catalyst (for Vacuum Bag-
   Autoclave Application)

5. Perkins D-111 with Boil-Proofing Catalyst (for Vacuum Bag-
   Autoclave Application)

6. Perkins Melamine-Urea Resin M-411 (Instructions for Vacuum
   Bag-Autoclave Application)

7. Perkins Liquid Urea-Formaldehyde Resin -L-100.
    a. Cold Pressing
    b. Hot Plate Pressing

8. Perkins L-100 with Addition of Boil-Proofing Catalyst.
    (Hot Plate Pressing)

9. Perkins Powdered Urea-Formaldehyde Resin D-111.
    a. Cold Pressing
    b. Hot Plate Pressing

10. Perkins Powdered Melamine-Urea Resin M-411.
    a. Cold Pressing, but Kiln Cure
    b. Hot Plate Pressing

11. Perkins DC-246, Instructions for Mixing and Application.

    o. Plaskon Division, Libby - Owens - Ford Glass Co.,
        2112-24 Sylvan Avenue, Toledo 6, Ohio:

1. Plaskon Series 900 Laminating Resins,

2. Plaskon Cold Setting Resin Glue, Type 201.

3. Plaskon Cold Setting Resin Glue, Instruction Manual for
    Ready-Mixed, Type 250-2.

4. Plaskon Hot Setting Resin Glue, Type 107.

5. Plaskon Resin Glue, Instruction Manual for Type 700-2
    Hot Setting Adhesive.

    p. Plastics Industries Technical Institute,
        186 South Alvarado St., Los Angeles 4, Calif.:

1. Instructions for Use of Cold Set Resin X Adhesive.

    q. Resinous Products and Chemical Co., Washington Square,
        Philadelphia 5, Pa.:

1. Resin Adhesives for Plywood, Tego, Amberlite, and Uformite
    (7th ed.), Oct. 1942.

2. Bulletin No. 2. Uformite CB-551 Cold Bonding Studies.
    April 1943.

3. Bulletin No. 3. Amberlite PR-14 Hot Pressing Studies,
    May 1943.

4. Bulletin No. 4. Flexible Bag Molding of Curved Plywood,
     May 1943.

5. Bulletin No. 5. Government Specifications for Plywood
     and Adhesives. Sept. 1943.

6. Bulletin No. 6. Edge Gluing and Taping of Plywood Veneer.
     Feb. 1944.

7. Amberlite PR-75-B with Catalyst P-79.

8. The Uformites, Cold Bonding Resin Adhesives.

9. Uformite CB-551 and Uformite CB-552, Cold Setting Resin
     Adhesives.

10. Catalyst Q-107 with Uformite 430 and Uformite 500.

11. Redux, for Bonding Metal to Metal.

12. Redux, for Bonding Metal to Metal and Metal to Wood.

13. Tego Tape, for Repairing Plywood Veneers.

14. Material 1142.

15. Edge Gluing of Lumber Cores with Uformite 500 and Catalyst
     Q-87.

    r. Swift and Co., 4115 Packers Ave., Chicago 9, Ill.:

1. Waterproof Adhesives Manufactured by Swift and Company
     Especially for Manufacturing, Sealing, and Labeling
     Containers for the Army, Navy, and Lend Lease.

    s. United States Stoneware Co.:

1. Reanite Cements.

          5. United States Government Reports

    a. National Advisory Committee for Aeronautics.:

1. von Hippel, Arthur R., and Dietz, A. G. H.: Curing of
     Resin-Wood Combinations by High-Frequency Heating.
     NACA TN No. 874, 1942.

2. Turner, P. S.:   The Problem of Thermal-Expansion Stresses.
      in Reinforced Plastics. NACA ARR, June 1942.

3. Rinker, R. C., Reinhart, F. W., and Kline, G. M.: Effect
      of pH on Strength of Resin Bonds. NACA ARR No. 3J11,
      1943.

4. Turner, Philip S., Doran, Jewel, and Reinhart, Frank W.:
      Fairing Compositions for Aircraft Surfaces. NACA TN
      No. 958, 1944.

5. Axilrod, B. M., and Jirauch, D. H.: Bonding Strengths of
      Adhesives at Normal and Low Temperatures. NACA TN No.
      964, 1945.

      b. United States Department of Agriculture Forest Service,
         Forest Products Laboratory:

1. Brouse, D.: Effect of Extending Hot Press, Urea-Resin
      Glue with Rye Flour on Strength and Durability of the
      Glue Joints. Rep. No. Z 1294, Apr. 1942.

2. Comparison of Cold-Setting, Urea-Resin Glues with Casein
      Glues for Joints in Aircraft Assemblies. Rep. No. 1331,
      Oct. 1941.

3. Kaufert, F. H.: Increasing the Durability of Casein Glue
      Joints with Preservatives. Rep. No. 1332, Oct. 1943.

4. Gabriel, A. E., and Cohodas, Leah E.: Analysis for Filler
      Content of Urea-Formaldehyde Glues. Rep. No. 1333,
      Sept. 1944.

5. Synthetic Resin Glues. Rep. No. 1336, Dec. 1941.

6. Glues for Use in Aircraft. Rep. No. 1337, Oct. 1941.

7. Testing and Mixing Aircraft Glues. Rep. No. 1338, Nov. 1941.

8. Control of Conditions in Gluing. Rep. No. 1340, Oct. 1941.

9. Eickner, H. W.: The Gluing Characteristics of 15 Species
      of Wood with Cold-Setting, Urea-Resin Glues. Rep. No.
      1342, April 1942.

10. Browne, F. L., Laughnan, Don, Heebink, Bruce G., and
      Fleischer, H. O.: Summary of a Study of Temperatures
      Attained in a Dummy Aircraft Wing during the Summer at
      Madison, Wisconsin. Rep. Nos. 1343-A and B., Jan. 1943.

11. Kaufert, F. H., and Richards, C. Audrey: Procedures for
        Measuring the Mold Resistance of Protein Glues. Rep.
        No. 1344, Sept. 1943.

12. Blomquist, R. F.: Effect of High and Low Temperatures on
        Resin Glue Joints in Birch Plywood. Rep. No. 1345,
        Jan. 1944.

13. Eickner, Herbert W.: Gluing of Thin Compreg. Rep. No.
        1346, March 1943.

14. Heebink, Bruce G.: Summary of Methods of Bag-Molding
        Plywood. Rep. No. 1347, April 1943.

15. Eickner, Herbert W.: The Gluing of Laminated Paper Plastic
        (Papreg). Rep. No. 1348, Jan. 1944.

16. Fleischer, Herbert O.: Substitutes for Rubber Bag Mate-
        rials in Making Molded Plywood. Rep. No. 1349, May 1943.

17. Heebink, Bruce G., and Fleischer, Herbert O.: Tests to
        Determine the Slipping Properties of Bag-Molding Glues
        in the Fluid Stage. Rep. No. 1350, May 1943.

18. Kaufert, F. H.: Preliminary Experiments to Improve the
        Gluing Characteristics of Refractory Plywood Surfaces
        by Sanding. Rep. No. 1351, June 1943.

19. Blomquist, R. F.: Determination of Degree of Cure of Low-
        Temperature Phenolic-Resin Glues by Solubility Methods.
        Rep. No. 1352, Sept. 1943.

20. Sanborn, W. A.: The Influence of Moisture Changes in Wood
        on the Shearing Strength of Glued-Joint Assemblies.
        Rep. No. 1524, Jan. 1945.

21. Wangaard, F. F.: Summary of Information on the Durability
        of Aircraft Glues. Rep. No. 1530, May 1944.

22. Bruce, H. D., Olson, W. Z., Black, J. M., and Rauch, A. H.:
        Gluing with Low-Temperature Setting Phenol, Resorcinol,
        and Melamine Glues. Rep. No. 1531, Dec. 1944.

23. The Use of Wood for Aircraft in the United Kingdom. Rep.
        of the Forest Products Mission. Rep. No. 1540, June 1944.

24. Paul, Benson H., and Limbach, John P.: Estimating the
        Specific Gravity of Plywood. Rep. No. 1589, June 1944.

25. Browne, F. L., Downs, L. E., Laughnan, D. F., and Schwebs,
      A. C.: Study of Temperature and Moisture Content in
      Wood Aircraft Wings in Different Climates. Rep. No.
      1597, Feb. 1944.

      c. Army Air Forces. Headquarters, Air Technical Service
            Command:

  1. Wyrostek, E. J.: Specification for Cement 1A. Rep. No.
        Eng. 56-M4723, Add. 1, July 1944.

  2. Specification No. 14122.

  3. Specification No. 26544.

  4. Specification No. 26571.

  5. Specification No. 26593.

  6. Specification No. AN-C-54.

  7. Specification No. AN-G-8.

  8. Wood Aircraft Inspection and Fabrication. ANC Bulletin
        No. 19, Dec. 1943.

      d. Navy Department, Bureau of Aeronautics, Naval Air Mate-
            rial Center, Philadelphia Naval Air Experimental
            Station:

  1. Dowling, Arthur P.: Investigation of Assembly Glues for
        Wood Aircraft. Rep. No. AMS(M)-684, April 1943.

  2. Dowling, A. P.: Physical Characteristics of Phenolic Resin
        Assembly Glues (Room Setting and Heat Setting) Compared
        with Urea-Resin and Casein Glues. Rep. No. NAM 2583,
        Part IV, April 1944.

  3. Dowling, A. P.: The Significance of pH in Glued Wood
        Joints. Rep. No. NAM 2583, Part V, June 1944.

  4. Dowling, A. P.: The Significance of Thick Glue Lines in
        Glued Wood Joints. Rep. No. NAM 2583, Part VI, Aug. 1944.

  5. Sandburg, J. R.: Tensile and Tearing Tests for Evaluating
        Wood Assembly Glue. Rep. No. NAM 2586, Part II, June
        1944.

6. Dowling, A. P.: Evaluation of the Fresh and Salt Water
     Resistance of Cycle-Welded and Cycle-Bonded Joints.
     Rep. No. NAM 25143, Part II, Jan. 1944.

7. Dowling, A. P.: The Effect of Heat and Water on Cycle
     Bonded Alclad-Wood Joints at Various Film-Thicknesses
     of Cycle-Weld Cement. Rep. No. NAM 25143, Part III,
     May 1944.

8. Dowling, A. P.: The Metlbond Series of Cements. Rep.
     No. NAM 25143, Part IV, Aug. 1944.

9. Dowling, A. P.: The Cycle-Weld Method of Securing Metal
     to Metal and Metal to Wood Joints in Aircraft Assemblies.
     Rep. No. NAM 25143, Part II, March 1944.

                  6. British Government Reports

     a. Royal Aircraft Establishment:

1. Pryor, M. G. M.: Adhesion of Glues to Plywood. Rep. No.
     Mat-N-1102-6, Sept. 1941.

2. Adhesives for Metals - Programme of Test for Sheet. Rep.
     No. Mat-N-2001-23-WDD-122, Oct. 12, 1943.

3. Pryor, M. G. M.: Adhesion of Glues to Plywood. Rep. No.
     Mat-N-1-2001, Sept. 1941.

4. Redux Adhesives for Light Alloys. Rep. No. Mat-N-1-14,086a,
     Oct. 1942.

5. Pryor, M. G. M., and Gordon, C. M.: Second Report on the
     Adhesion of Glues to Plywood. Rep. No. Mat-N-2-2001,
     Jan. 1944.

6. Test Report on Redux Adhesives. Rep. No. Mat-N-2007-3-
     NJFC-122, March 1944.

7. Bedwell, L. M. E.: Investigation into the Setting Process
     of Phenol-Formaldehyde Resins. Rep. No. Mat-N-2-3008,
     May 1944.

8. Aging of Urea-Formaldehyde Adhesive to DTD-484. Rep. No.
     Mat-N-4-2051, April 1944.

b. Ministry of Aircraft Production Scientific and
    Technical Memoranda:

1. Investigation into Glues and Gluing. Rep. No. 31, STM
    No. 5-43.

2. High Temperature Wet Tests on Cold-Setting Synthetic Resin
    Adhesives - Investigation into Glues and Gluing. Rep.
    No. 32, STM No. 9-43.

3. Campbell, W. G., and Packman, D. F.: Chemical Factors
    Involved in the Gluing of Wood with Cold-Setting Urea-
    Formaldehyde Glues (2d rep.)   The Effects Induced
    by Cold-Setting U-F Glues on the Physical Properties
    of Wood in Wood-Glue Composites. STM No. 11-43.

4. Little, G. E., and Pepper, K. W.: Synthetic Resin Glues -
    I. STM No. 19-43, Oct. 1943.

5. Hearmon, R. F. S.: The High Frequency Electrical Proper-
    ties of Wood and Wood-Resin Combinations. STM No.
    C4-44, March 1944.

6. Insolation Effects in Aircraft Wings and the Psychrometric
    Durability of Glues. STM No. 8-44.

7. Campbell, W. G., and Bryant, S. A.: Chemical Factors
    Involved in the Gluing of Wood with Cold-Setting Urea-
    Formaldehyde Resins (3d rep.)   A Consideration of
    the Causes of the Decline in Failing Load of Gap Joints
    during Prolonged Storage under Controlled Conditions.
    STM No. 9-44, Jan. 1944.

8. Fatigue Tests on Joints Made in DTD-390 Using Redux
    Cement. STM No. c9-44.

9. The Effect of Temperatures on the Strength Properties of
    Wood, Plywood, and Glued Joints. STM No. 12-44.

10. de Bruyne, N. A., Kemball, C., Brech, G., Campbell, W. G.,
    and Cooper, B.: Fundamentals of Adhesion. Oct. 1943.

c. Forest Products Research Laboratory, Princes Risborough:

1. The Identification of Plywood Glues.

2. Temperature and Moisture Content Conditions in Wooden Air-
    craft and Their Influence on the Durability of Glue
    Joints. Research Program for the Summer of 1943.

3. The Bonding of Tego Film Glue in Plywood.

4. Chemical Factors Involved in the Gluing of Wood with
      Cold-Setting Urea-Formaldehyde Resins.

5. The Influence of Surface Finish and Grain Direction on
      the Strength of Glued Joints of Sitka Spruce. Rep.
      No. 2.

6. Development of a Wet Test for Plywood Made with Urea-
      Formaldehyde Glue. Rep. No. 5.

7. Beech as a Timber for Glue Test Samples. Rep. No. 6.

8. The Moisture Resistance of Glues in Plywood. Rep. No. 8.

9. Taped Joints in Plywood. Rep. No. 11.

10. Tests on Catacol Cold-Setting P.F. Resin. Rep. No. 12.

11. Development of Standard Glue Tests Using the Two-Ply
      Sample. Rep. No. 13.

12. Formaldehyde Treatment of Casein Joints. Rep. No. 14.

13. Further Experiments on Formaldehyde Treatment of Casein
      Joints. Rep. No. 15.

14. The Moisture Resistance of Paints for Casein Joints.
      Rep. No. 17.

15. First Report on the U. F. Resin Adhesive Beetle. Rep.
      No. 19.

16. Comparative Tests on Three Rolls of Tego Glue Film. Rep.
      No. 20.

17. Factors in the Gluing of Improved Wood. Rep. No. 22.

18. Factors in Gluing of Improved Wood and Plastics. Rep.
      No. 25.

19. Revision of Casein Glue Specification B.S. 3V2. Rep.
      No. 26.

20. Proposed Specifications for Cold-Setting Synthetic Resin
      Glues. Rep. No. 28, Sept. 1942.

NACA TN No. 989   93

21. The Separate Application Method in the Use of Beetle A.
        Rep. No. 29.

22. The Separate Application Method in the Use of Beetle A.
        Rep. No. 29-B.

23. Tests on Synthetic Resin Adhesives for Plywood.
        Rep. No. 31.

24. High Temperature Wet Tests on Cold-Setting Synthetic
        Resin Adhesives. Rep. No. 32.

25. Weathering Qualities of Plywood Glues. Rep. No. 36,
        March 1944.

26. Influence of Time on the Strength of Glued Joints.
        Summary No. 2.

27. The Two Ply Glue Test Sample. Summary No. 3.
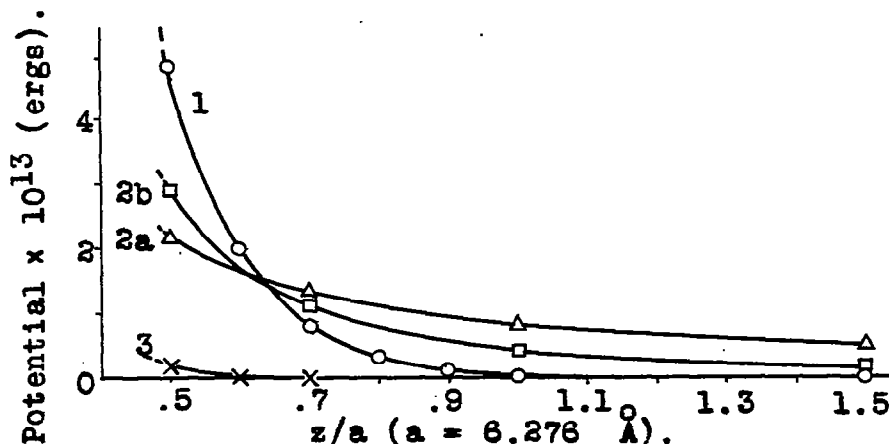
Figure 1.- The potential field outside a (100) plane of KOl
            on a charged particle (ourve 1) and on argon
(curve 2). (From Lennard-Jones and Dent).

Curve 1.- Electrostatic force between the crystal and
            charged particle.
Ourves 2a and 2b. Van der Waals forces between the crystal
            and an argon atom.
Curve 3.- Force due to polarization of the crystal by the
            charged particle.
The forces are calculated for a particle at a distance "z"
from the crystal surface in which the ions are separated by
the distance "a".
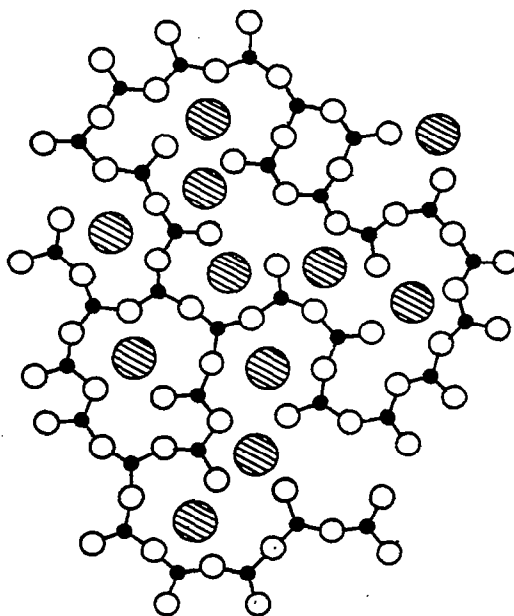
● Si   ○ O   ◍ Na

Figure 2.- Schematic repre-
            sentation in two
dimensions of the structure of
soda-silica glass. (From Warren).
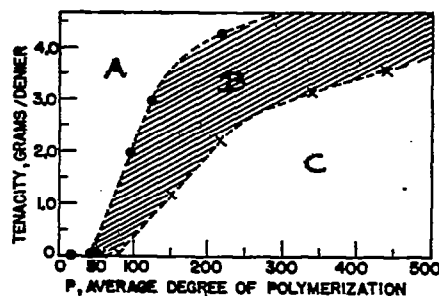
Figure 3.- Effect of
            average
degree of polymeriza-
tion on tenacity of
high polymers. (From
Mark).

A.- Fibrous area
B.- Plastic area
C.- Rubbery area
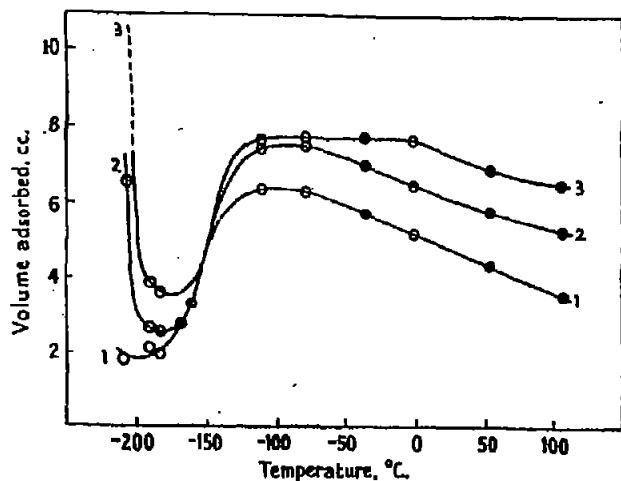
Figure 4.- Adsorption of hydrogen on
nickel. (From Benton and
White).

Curve 1.- 25 mm pressure
Curve 2.- 200 mm pressure
Curve 3.- 600 mm pressure

Figure 5.- The Bartell cell. (From Bartell
and Osterhof).
A.- Section wet with highly wetting liquid.
B.- Section wet with poorly wetting liquid.

Glue joint
Detail of test specimen 1

Oil hole
Test specimen

SECTION A-A

Figure 7.- Block shear specimen and
tool. (From ANC-19).

CUT ⅔ THROUGH CORE

SPECIMEN A

CUT ⅔ THROUGH CORE
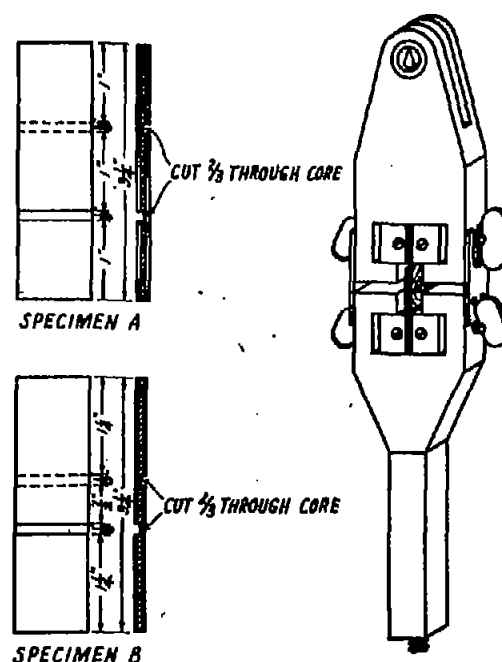
SPECIMEN B

Figure 8.- Plywood shear specimens
and grips. (From ANC-19).
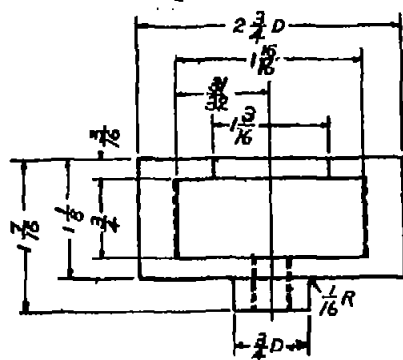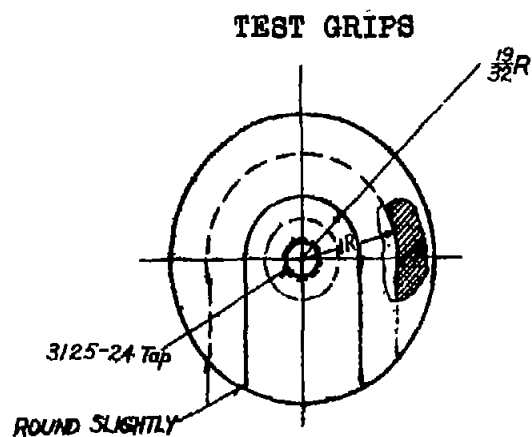
TEST GRIPS   WOOD TEST SPECIMEN   METAL TEST SPECIMEN
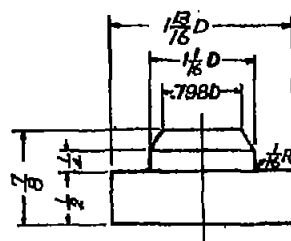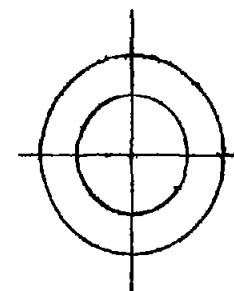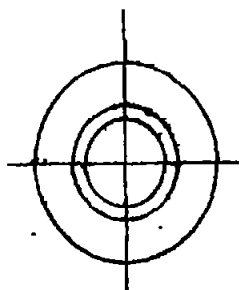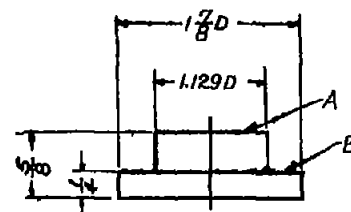
FIG. 1   FIG. 2A   FIG. 2B

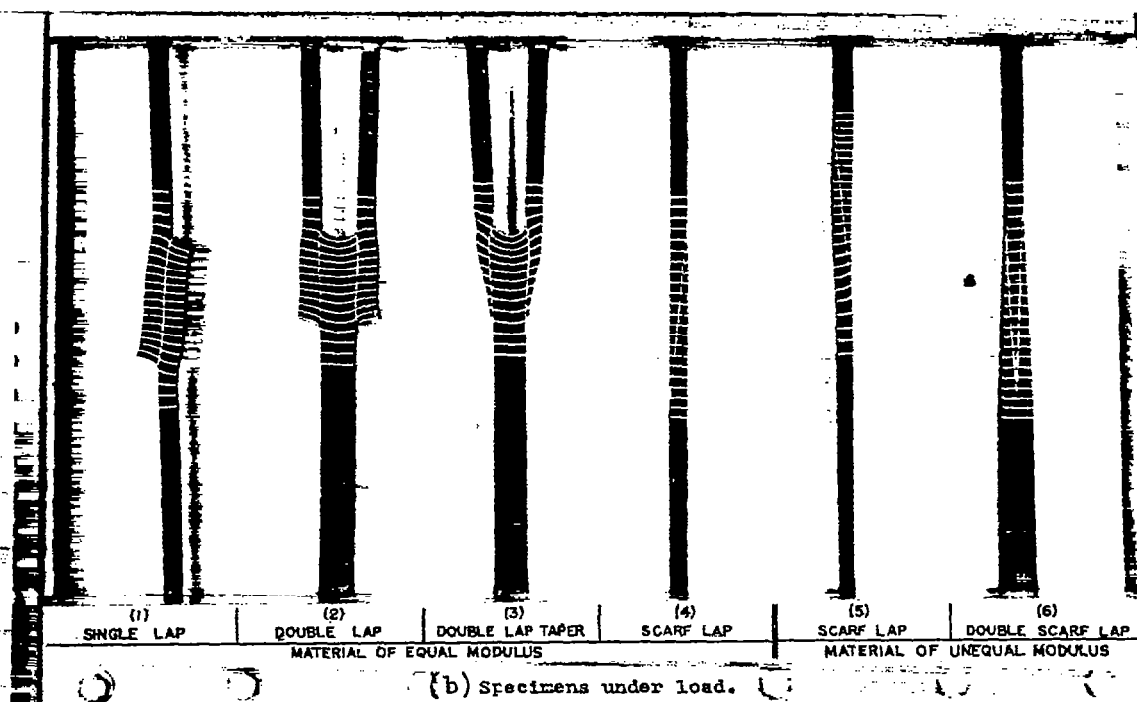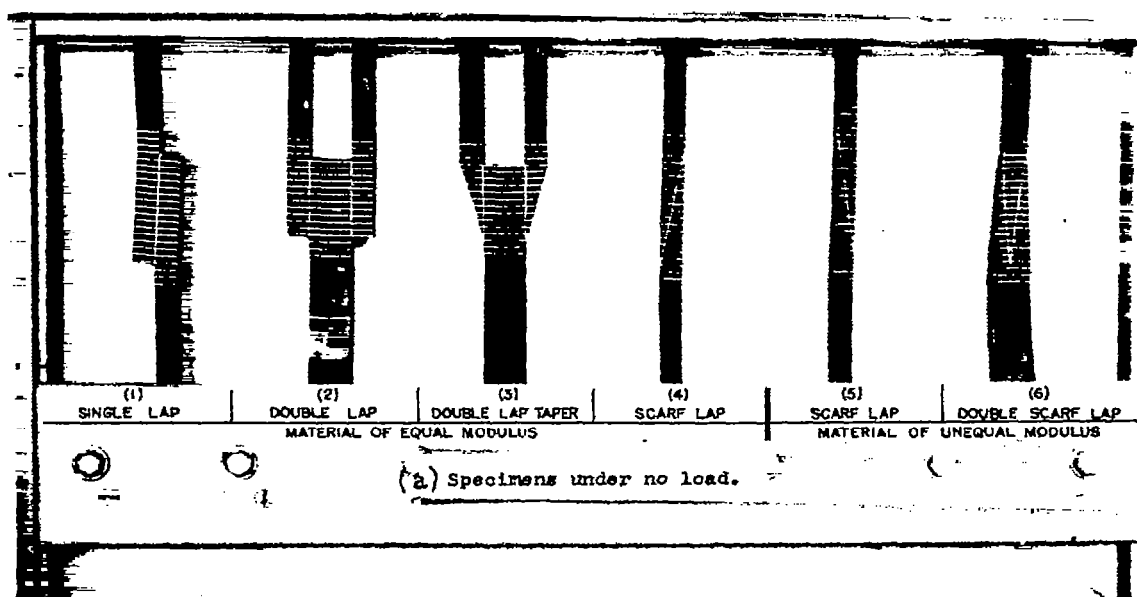Figure 6. - Tensile test specimen (From Platow, reference 46).

Fig. 6

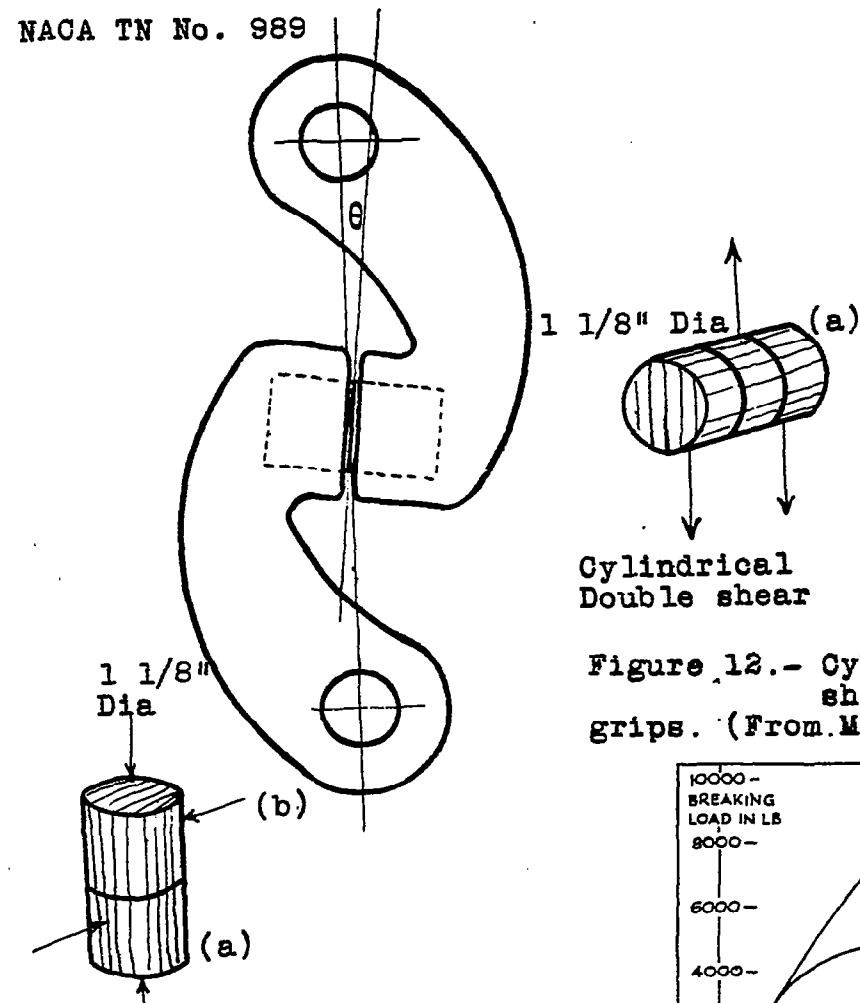Figure 9.- Distribution of stresses in shear test specimens.
　　　　　(From Jackson).

1 1/8" Dia   (a)

Cylindrical
Double shear

1 1/8"
Dia
(b)

(a)

**Figure 10.- Cylindrical single
        shear specimen and
grips. (From McBain).**

(b)

**Figure 12.- Cylindrical double
            shear specimen and
grips. (From McBain).**
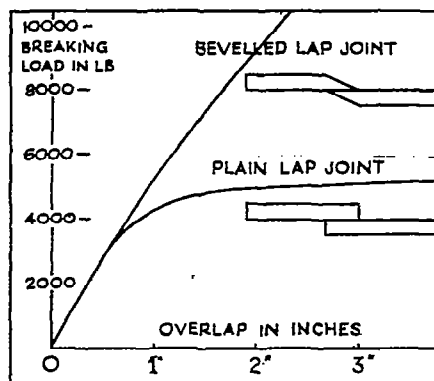
10000 -
BREAKING
LOAD IN LB   BEVELLED LAP JOINT
8000 -

6000 -
                    PLAIN LAP JOINT

4000 -

2000

                    OVERLAP IN INCHES

O   1"   2"   3"

**Figure 14.- Shear strengths of
            tapered and untapered
lap joint specimens. (From de Bruyne)**

UNSTRESSED

THE DIFFERENTIAL STRAINS IN
A LAP JOINT UNDER LOAD CAN
BE MADE EVIDENT BY DRAWING
REFERENCE MARKS ON THE MEMBERS

STRESSED

THE GLUE LAYER SHOWN HERE
EXAGGERATED IN THICKNESS
HAS TO ACCOMMODATE ITSELF TO

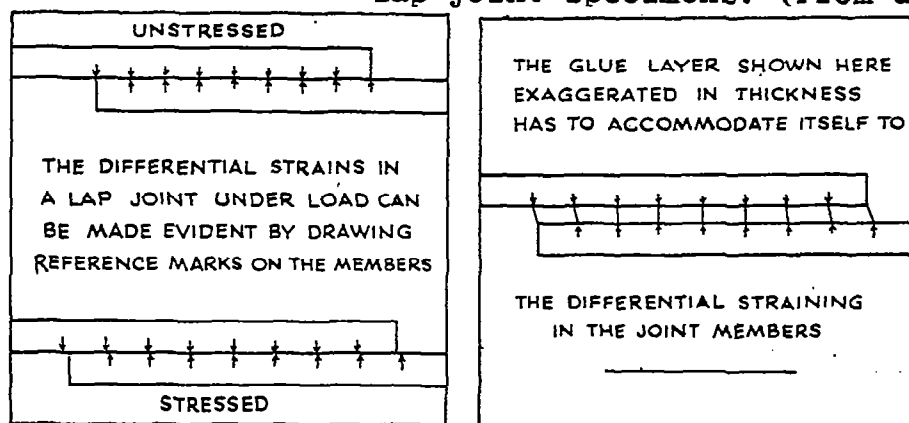THE DIFFERENTIAL STRAINING
IN THE JOINT MEMBERS

**Figure 13.- Concentration of stress due to a differential
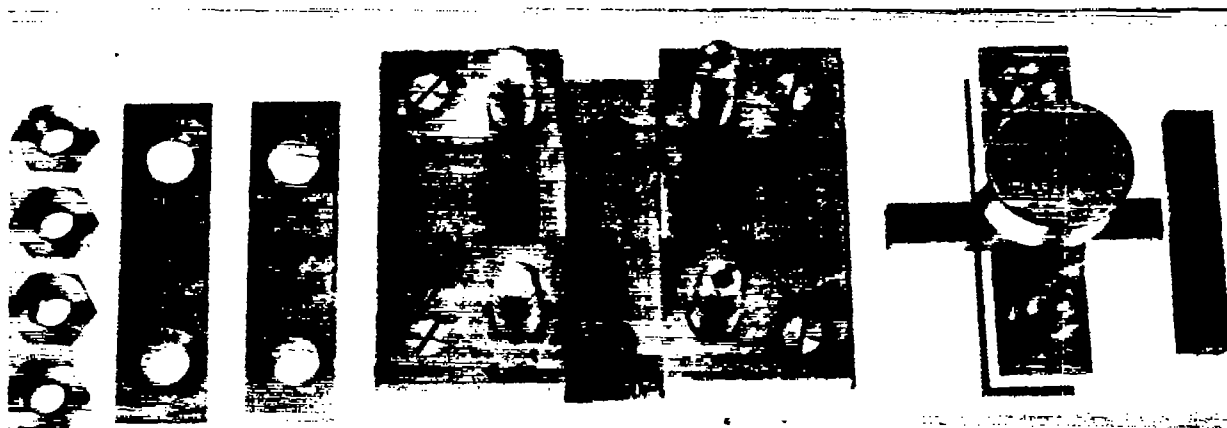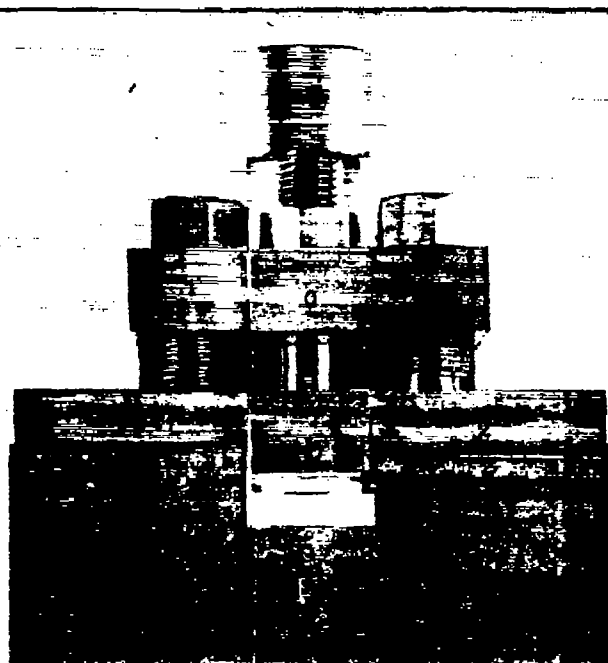   strain in a lap joint specimen. (From de Bruyne).**

Figure 11.- Johnson double shear specimen and tool.